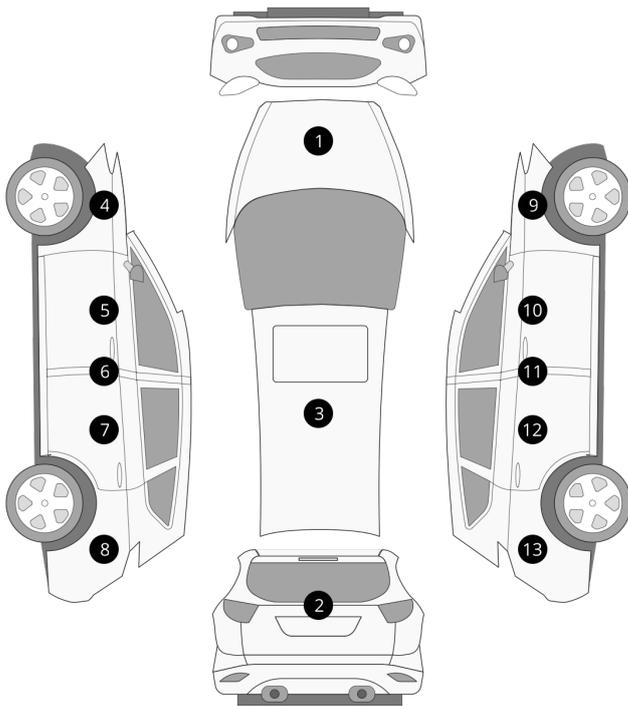


General Information

Date & Time: 26, Aug, 2025 13:16

Make	Toyota	Model	Fortuner
YOM	2022	Odo Meter Reading	55,169
Registration No.	NIB5302	Chassis No.	MHFCB8GS4N0524874
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



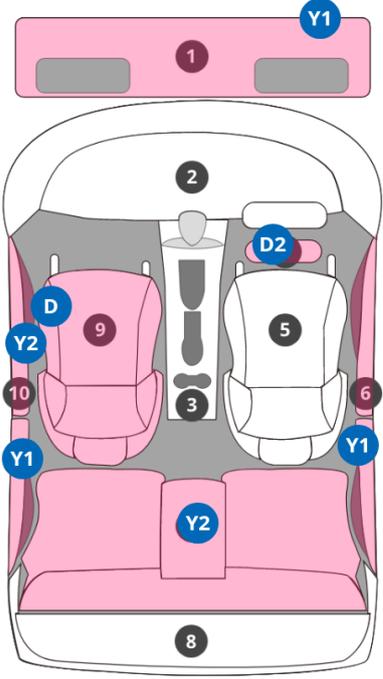
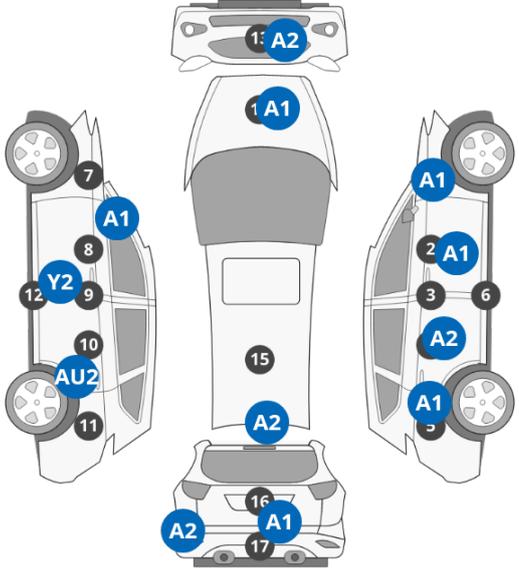
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.0	126	132	120
2	Boot Lid	105.9	95	120	103
3	Roof	118.2	130	123	109/111
4	Left Front Fender	115.3	115	113	118
5	Left Front Door	118.3	109	127	119
6	Center Panel Left				
7	Left Rear Door	105.9	121	98	99
8	Left Back Panel	118.6	125	113	118
9	Right Front Fender	118.0	112	115	127
10	Right Front Door	113.6	118	117	106
11	Center Panel Right				
12	Right Rear Door	106.7	95	108	117
13	Right Back Panel	124.6	133	114	127

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Crack, Gap - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, rear left door speaker issue</p>