

## General Information

Date & Time: 29, Aug, 2025 09:11

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	51,422
<b>Registration No.</b>	NFG9407-1	<b>Chassis No.</b>	MR0JB8DD0M3186171
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Black		

## Body / Panel Condition



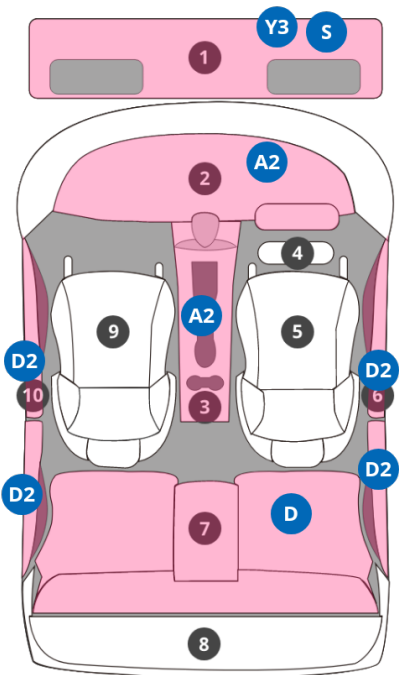
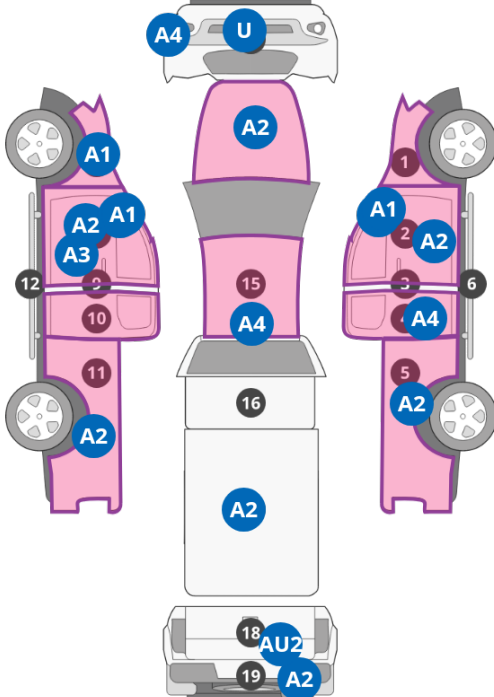
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	213.0	168	199	272
2	Boot Lid	230.0	248	274	168
3	Roof	118.2	102	104	106/161
4	Left Front Fender	696.0	648	802	638
5	Left Front Door	388.6	576	213	377
6	Center Panel Left				
7	Left Rear Door	199.3	185	222	191
8	Left Back Panel	189.0	191	191	185
9	Right Front Fender	782.0	454	1,245	647
10	Right Front Door	154.0	175	146	141
11	Center Panel Right				
12	Right Rear Door	240.0	149	435	136
13	Right Back Panel	167.0	188	139	174

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Overall Interior - Smell - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small / Rear Seat - Worn - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch &amp; Dent - Small / (L) Side Gate - Scratch - Small / (L) Side Gate - Repair mark - Yes / (R) Side Gate - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Roof - Repair mark - Yes / Roof - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Member (Bolted) - Dent - Yes / (R) Mirror - Faded(Color, Gloss) - Yes / (L) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Side Gate - Scratch - Small / Cargo Bed Floor - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Sparetire ,No Tools, No Jack, No warranty booklet, No LTO PLATE, scratch headlight and tail light, adhesive marks on body of vehicle, Missing some parts. worn tires and Sparetire.</p>