

General Information

Date & Time: 01, Sep, 2025 15:11

Make	Toyota	Model	Lite Ace
YOM	2025	Odo Meter Reading	7,530
Registration No.	NHU3593	Chassis No.	MHKU3FE10RK008950
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Commercial Vehicles
Colour	White		

Body / Panel Condition



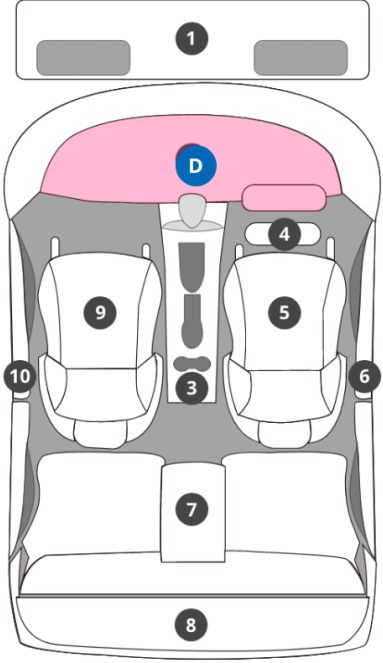
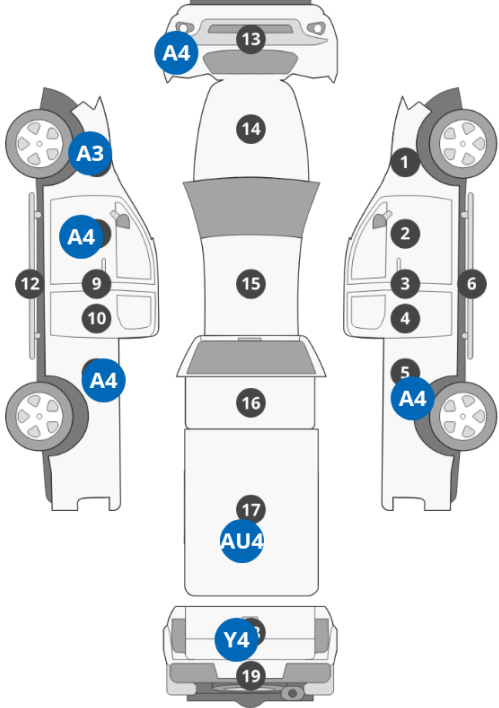
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	59.5	61	62	56
2	Boot Lid	79.1	100	77	61
3	Roof	64.5	68	63	61/66
4	Left Front Fender	64.8	70	69	55
5	Left Front Door	65.2	69	62	65
6	Center Panel Left	50.5	46	39	67
7	Left Rear Door				
8	Left Back Panel	72.2	62	74	81
9	Right Front Fender	63.0	71	60	58
10	Right Front Door	55.9	56	59	53
11	Center Panel Right	73.1	79	63	78
12	Right Rear Door				
13	Right Back Panel	137.2	189	129	94

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Side Gate - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Side Gate - Scratch - Large / Rear Gate - Crack, Gap - Large / Cargo Bed Floor - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no tools and jack/ with spare tire and LTO plate/