

General Information

Date & Time: 29, Aug, 2025 15:01

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	19,299
Registration No.	DBO5449	Chassis No.	PA1B18F37R4239125
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



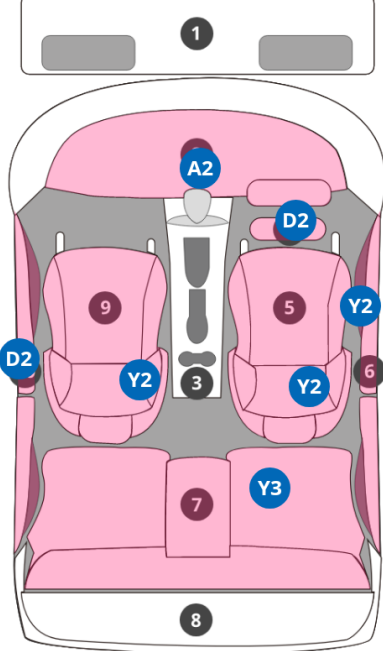
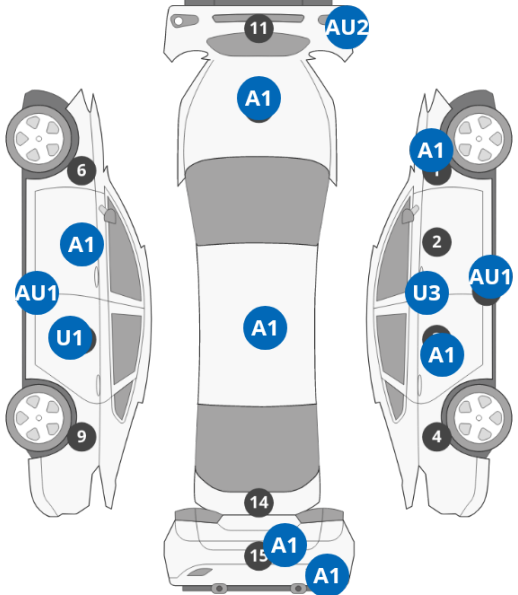
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.0	128	81	106
2	Boot Lid	111.0	106	110	117
3	Roof	105.0	111	103	95/111
4	Left Front Fender	101.6	101	97	107
5	Left Front Door	102.2	105	100	102
6	Center Panel Left				
7	Left Rear Door	103.5	111	105	95
8	Left Back Panel	109.6	107	112	110
9	Right Front Fender	101.4	104	104	96
10	Right Front Door	103.3	103	101	106
11	Center Panel Right				
12	Right Rear Door	112.0	115	105	116
13	Right Back Panel	115.3	115	110	121

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Worked - Small</p>	<p>Remarks (L) Rear Door, Molding - Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (R) Front Door, Molding - Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet and scratch headlight and tail light. mold on some parts seats and floor matting.</p>