

General Information

Date & Time: 02, Sep, 2025 10:14

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	99,177
Registration No.	NIG7498	Chassis No.	PA1B18F35N4199105
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



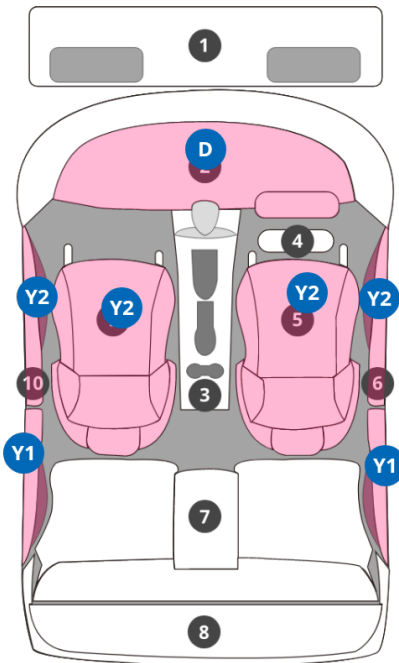
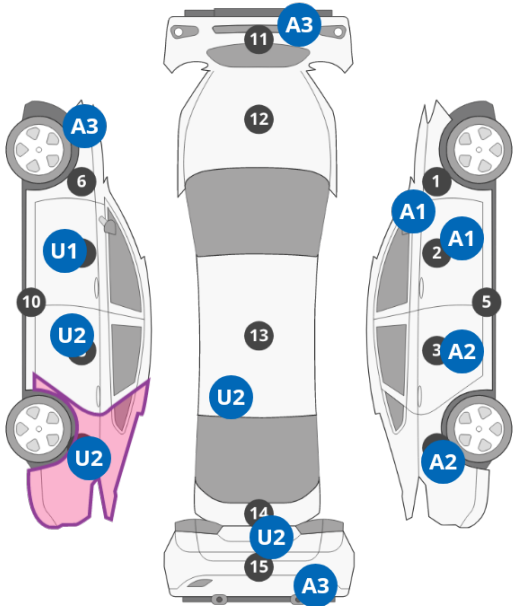
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	118	117	105
2	Boot Lid	105.3	100	108	108
3	Roof	99.1	100	97	96/104
4	Left Front Fender	99.6	103	98	98
5	Left Front Door	107.0	103	115	103
6	Center Panel Left				
7	Left Rear Door	105.3	103	103	110
8	Left Back Panel	355.6	543	330	194
9	Right Front Fender	98.6	105	96	94
10	Right Front Door	103.5	111	100	100
11	Center Panel Right				
12	Right Rear Door	101.3	95	100	110
13	Right Back Panel	98.9	98	94	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Dent - Minimal / (L) Rear Door, Molding - Dent - Small / (L) Rear Fender, Molding - Dent - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No reverse camera/No warranty booklets/with jack No tools/plate light issue/No spare key</p>