

General Information

Date & Time: 01, Sep, 2025 13:43

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	50,669
Registration No.	NIQ5879	Chassis No.	PA1B18F31P4228540
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



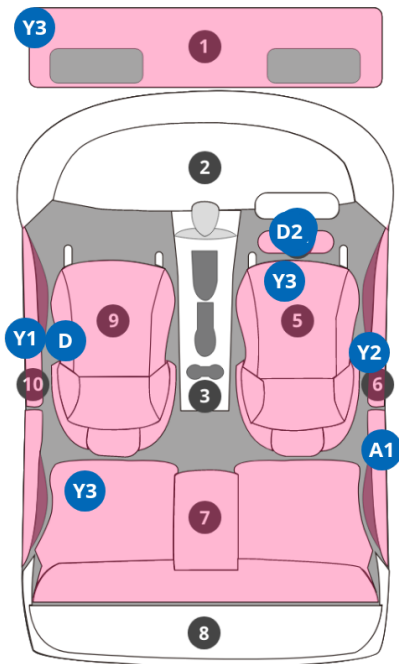
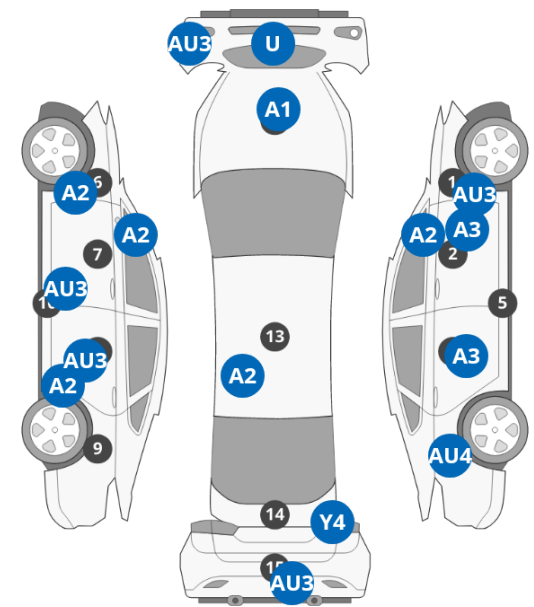
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	112	109	118
2	Boot Lid	111.3	102	113	119
3	Roof	102.8	100	99	105/108
4	Left Front Fender	102.6	105	103	100
5	Left Front Door	98.5	99	101	96
6	Center Panel Left				
7	Left Rear Door	99.3	103	100	95
8	Left Back Panel	112.3	128	109	100
9	Right Front Fender	105.0	108	100	107
10	Right Front Door	118.3	131	114	110
11	Center Panel Right				
12	Right Rear Door	117.3	102	113	137
13	Right Back Panel	122.6	123	118	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / Mat Other - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Cut, Crack - Medium / Carpet - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Medium / (L) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Crack, Gap - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, hard to shift</p>