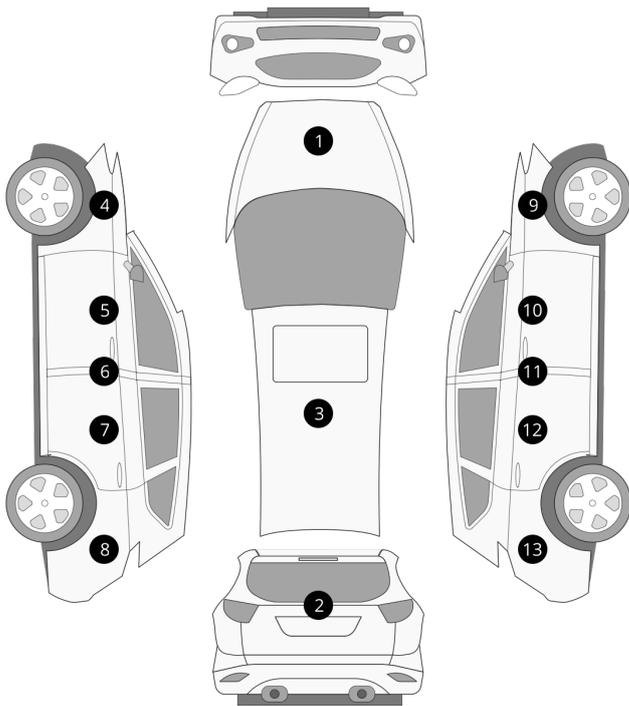


## General Information

Date & Time: 03, Dec, 2024 16:58

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Mileage</b>	22,468
<b>Registration No.</b>	NFJ7459	<b>Chassis No.</b>	PA1B18F34N4170596
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



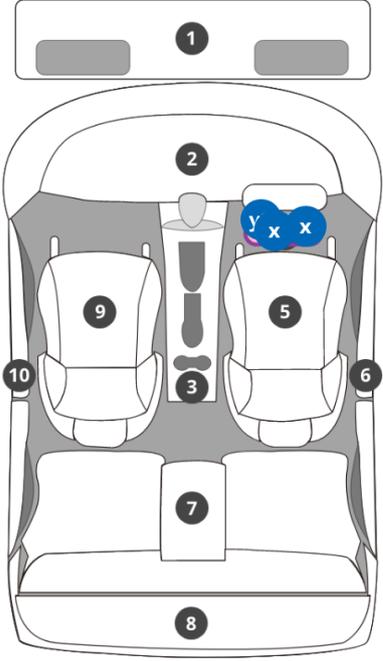
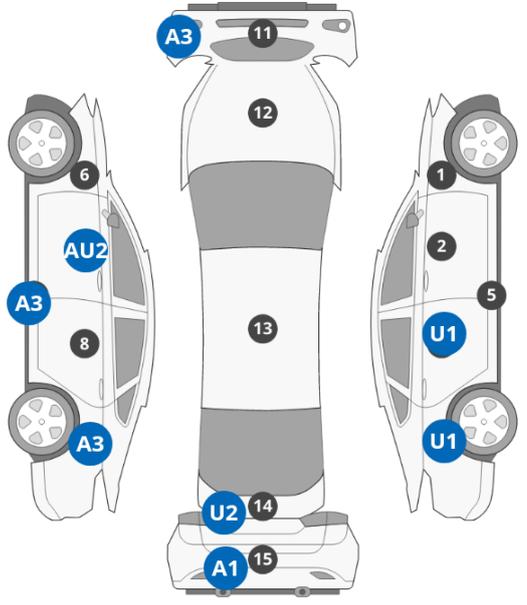
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	150.6	142	154	156
2	Boot Lid	100.1	97	103	100
3	Roof	99.8	100	99	97/103
4	Left Front Fender	103.3	109	101	100
5	Left Front Door	136.3	147	132	130
6	Center Panel Left				
7	Left Rear Door	146.0	165	142	131
8	Left Back Panel	99.9	101	99	100
9	Right Front Fender	100.1	98	101	102
10	Right Front Door	95.6	92	93	102
11	Center Panel Right				
12	Right Rear Door	99.2	101	100	97
13	Right Back Panel	97.2	96	98	98

Overall Evaluation :

**A**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Grime - Small / Mat Other - Missing - Yes</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (R) Rear Door, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Dent - Minimal / (L) Rear Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>swirlmarks and hairline scratches around the exterior. with warranty booklet and user manual. no tools.</p>