

General Information

Date & Time: 04, Sep, 2025 15:32

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	43,158
Registration No.	DBP2619	Chassis No.	PA1B18F33R4261929
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



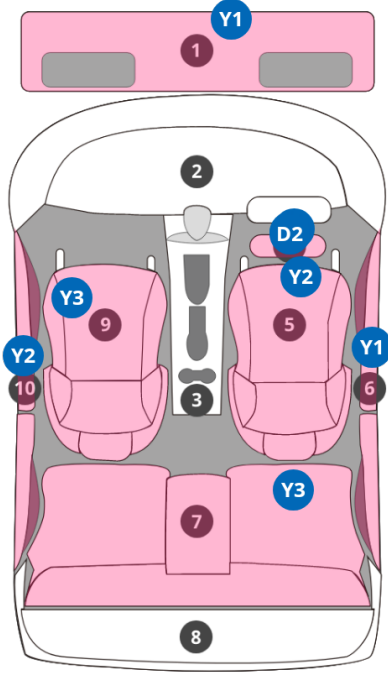
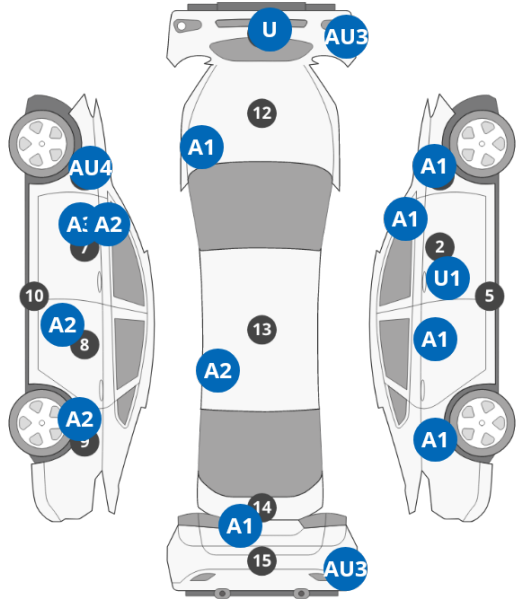
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	111	107	116
2	Boot Lid	110.6	108	113	111
3	Roof	102.6	109	107	100/94
4	Left Front Fender	100.6	98	100	104
5	Left Front Door	103.6	100	101	110
6	Center Panel Left				
7	Left Rear Door	103.7	117	100	94
8	Left Back Panel	113.2	125	116	99
9	Right Front Fender	100.7	100	96	106
10	Right Front Door	104.0	110	101	101
11	Center Panel Right				
12	Right Rear Door	110.6	111	108	113
13	Right Back Panel	111.0	103	110	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratched and cracked tail light, plate light issue</p>