

General Information

Date & Time: 08, Sep, 2025 10:34

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	51,232
Registration No.	NFR6073	Chassis No.	PA1B18F3XR4255268
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



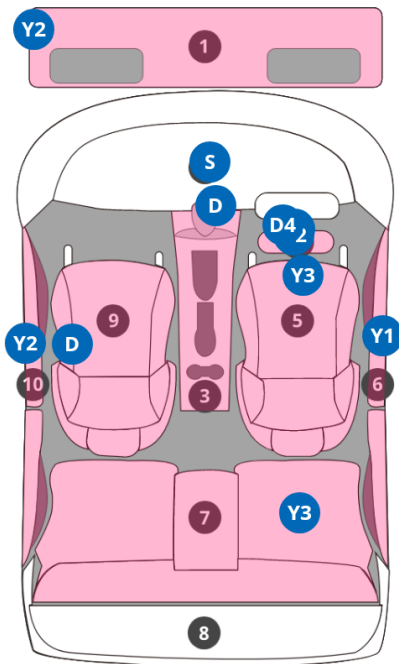
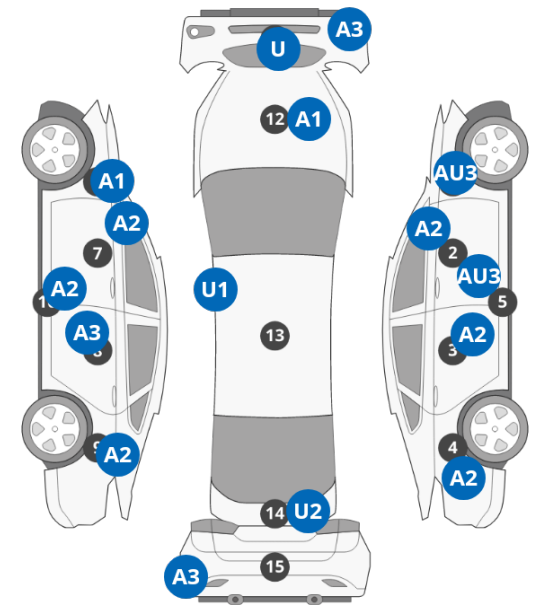
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	113	111	123
2	Boot Lid	105.4	111	97	108
3	Roof	102.4	106	99	94/111
4	Left Front Fender	99.9	102	100	98
5	Left Front Door	104.3	100	107	106
6	Center Panel Left				
7	Left Rear Door	107.3	113	103	106
8	Left Back Panel	108.6	110	113	103
9	Right Front Fender	103.6	102	103	106
10	Right Front Door	109.0	108	110	109
11	Center Panel Right				
12	Right Rear Door	114.0	102	113	127
13	Right Back Panel	107.0	106	104	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / Mat Other - Worked - Small / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Large / (L) Front Trim - Grime - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, trunk cover deformed</p>