

General Information

Date & Time: 05, Sep, 2025 14:23

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	39,593
Registration No.	NIQ5566	Chassis No.	PA1B18F32P4228627
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



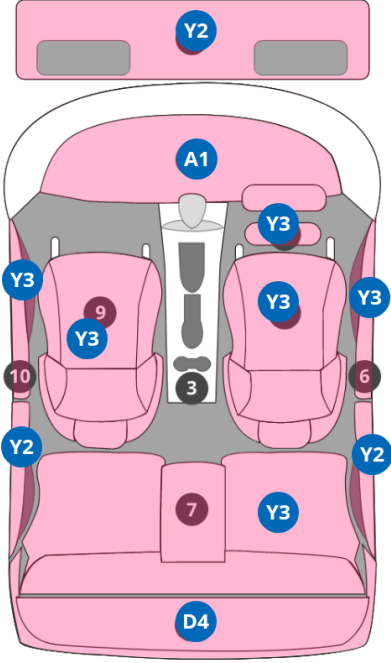
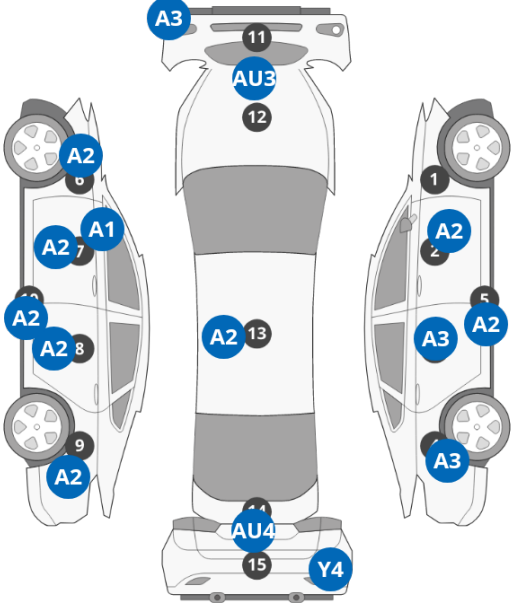
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.1	105	105	99
2	Boot Lid	114.3	108	109	126
3	Roof	94.3	98	95	92/92
4	Left Front Fender	107.0	113	104	104
5	Left Front Door	103.6	106	104	101
6	Center Panel Left				
7	Left Rear Door	112.0	106	121	109
8	Left Back Panel	112.3	123	109	105
9	Right Front Fender	100.8	104	96	103
10	Right Front Door	97.8	100	94	99
11	Center Panel Right				
12	Right Rear Door	98.3	100	96	100
13	Right Back Panel	104.3	104	100	109

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Loose, Deformed - Large / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal	Remarks Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Large / Roof - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : B	Functional Evaluation : B
Remarks Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with spare tire/No reverse camera/No warranty booklet/with jack/ No tools/with spare key/possible flooding/foul smell/trunk room traces of bending/trunk room not close