

General Information

Date & Time: 08, Sep, 2025 09:45

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	20,871
Registration No.	DBP1955	Chassis No.	PA1B18F31R4258477
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



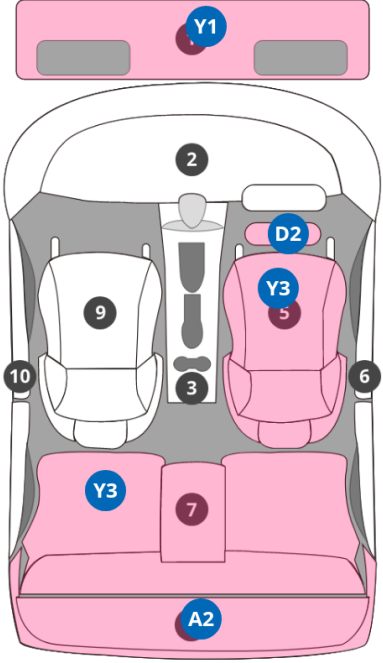
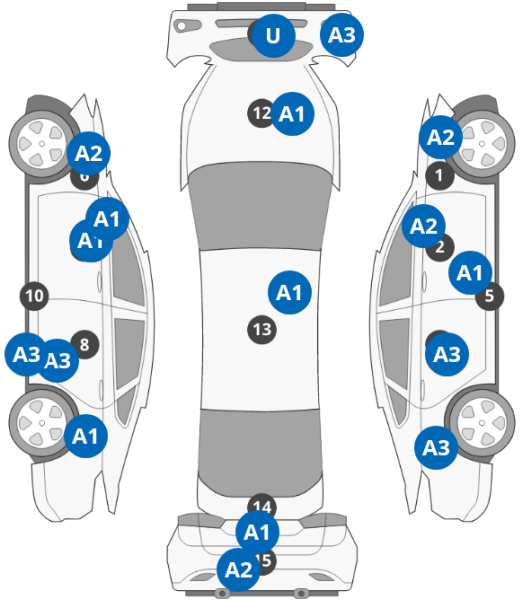
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	116	101	111
2	Boot Lid	120.6	111	123	128
3	Roof	110.0	112	102	107/119
4	Left Front Fender	102.5	101	98	109
5	Left Front Door	101.5	111	95	99
6	Center Panel Left				
7	Left Rear Door	104.2	107	99	107
8	Left Back Panel	107.7	116	108	99
9	Right Front Fender	100.0	101	99	100
10	Right Front Door	103.3	105	95	110
11	Center Panel Right				
12	Right Rear Door	101.0	100	96	107
13	Right Back Panel	112.0	108	117	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Medium</p>	<p>Remarks (R) Step - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : C	Functional Evaluation : C
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, scratches on tail light