

General Information

Date & Time: 08, Sep, 2025 10:19

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	39,637
Registration No.	NFE8424	Chassis No.	MHKA4DF5FNJ072127
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Yellow		

Body / Panel Condition



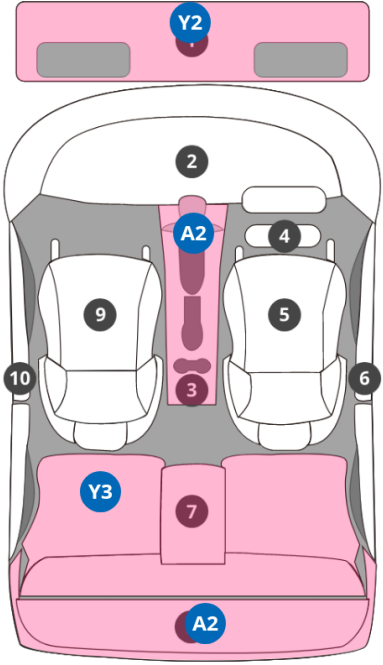
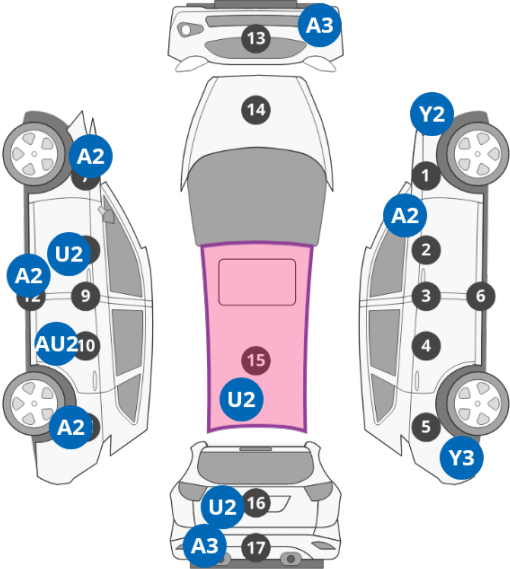
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.0	104	102	106
2	Boot Lid	113.6	109	118	114
3	Roof	197.7	187	211	192/201
4	Left Front Fender	107.4	96	111	115
5	Left Front Door	109.6	113	114	102
6	Center Panel Left				
7	Left Rear Door	108.0	106	107	111
8	Left Back Panel	98.3	111	93	92
9	Right Front Fender	111.0	112	120	101
10	Right Front Door	115.6	112	118	117
11	Center Panel Right				
12	Right Rear Door	110.0	112	111	107
13	Right Back Panel	116.0	124	114	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (R) Rear Fender, Molding - Crack, Gap - Medium / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Crack, Gap - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Repair mark - Yes / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Seat Belts - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with jack and incomplete tools/with reverse camera/with spare key/roof wrap in color black/seatbelts issue</p>