

General Information

Date & Time: 08, Sep, 2025 09:51

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	28,820
Registration No.	NFI1438	Chassis No.	PA1B18F32M4153925
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



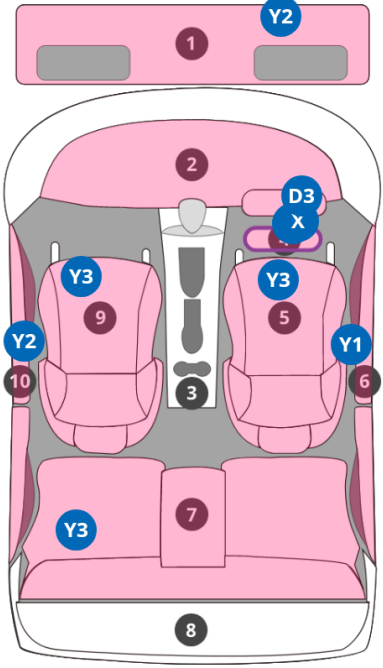
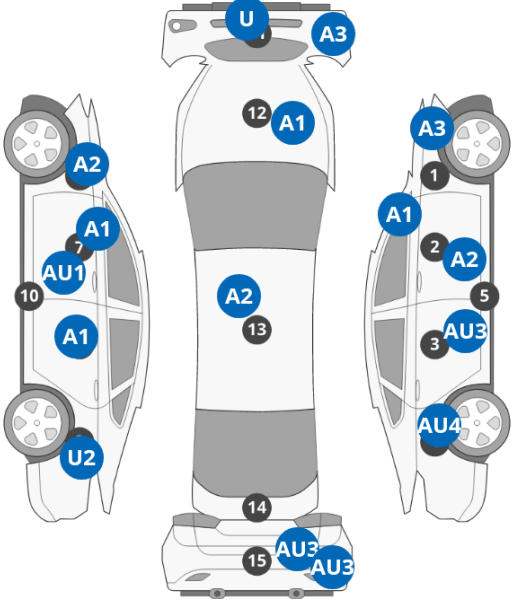
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	117	110	114
2	Boot Lid	100.8	95	100	107
3	Roof	103.1	104	103	106/100
4	Left Front Fender	96.5	99	98	93
5	Left Front Door	95.3	98	95	93
6	Center Panel Left				
7	Left Rear Door	127.6	137	122	124
8	Left Back Panel	106.2	103	98	118
9	Right Front Fender	94.3	91	99	93
10	Right Front Door	102.0	103	104	99
11	Center Panel Right				
12	Right Rear Door	110.2	99	106	126
13	Right Back Panel	106.3	104	102	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Minimal / Glove Box - Loose, Deformed - Medium / (L) Front Trim - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack, incomplete tools, no spare tire, no LTO plate, no wiper blades, trunk cover missing, scratched and suncrack tail lights</p>