

## General Information

Date & Time: 03, Sep, 2025 14:49

<b>Make</b>	Suzuki	<b>Model</b>	APV
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	80,238
<b>Registration No.</b>	NEA9334	<b>Chassis No.</b>	MHYDN71T4KJ400494
<b>CC</b>	1.6	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Van
<b>Colour</b>	White		

## Body / Panel Condition



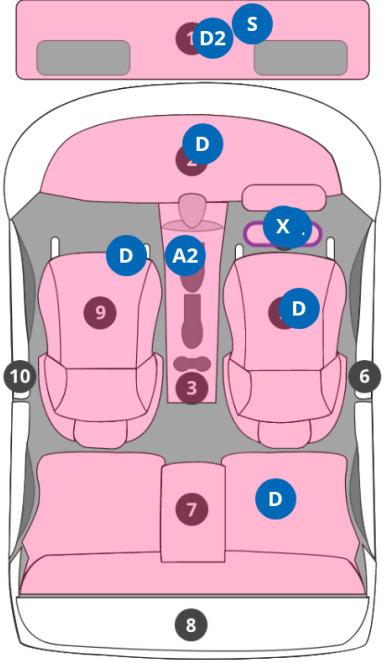
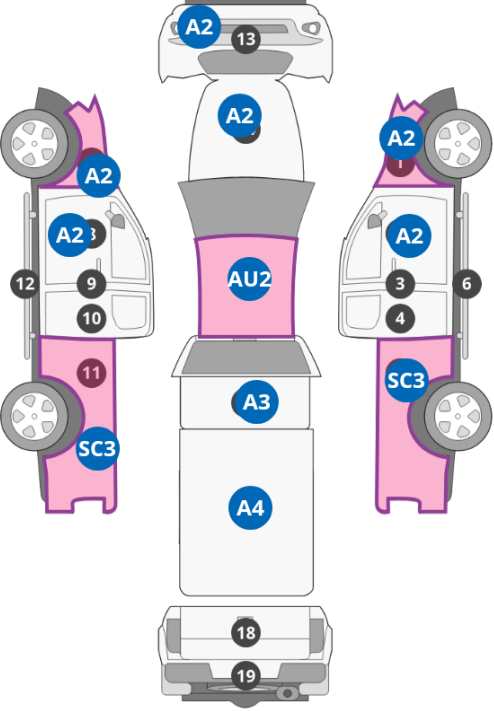
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	156.0	169	154	145
2	Boot Lid	169.6	186	174	149
3	Roof	122.7	97	93	155/146
4	Left Front Fender	187.6	212	177	174
5	Left Front Door	163.6	149	167	175
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	175.6	171	180	176
9	Right Front Fender	144.6	152	137	145
10	Right Front Door	161.3	186	156	142
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	185.0	208	165	182

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Worked - Small / Mat Other - Missing - Yes / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / Ceiling - Loose, Deformed - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Side Gate - Repair mark - Yes / (R) Side Gate - Repair mark - Yes / Roof - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Side Gate - Rust, Corrosion - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Rust, Corrosion - Medium / Roof - Scratch &amp; Dent - Small / Cargo Bed Floor - Scratch - Large / Cab Back Panel - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate, Sparetire, No warranty booklet and Tools and Jack, crack tail light and scratch headlight and tail light, battery weak, no aircon, no spare key, worn tires</p>