

General Information

Date & Time: 05, Sep, 2025 15:32

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	17,219
Registration No.	CAZ8349	Chassis No.	PA1B18F3XP4228715
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



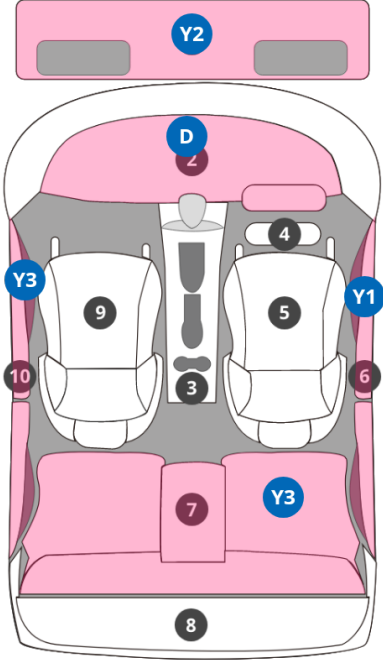
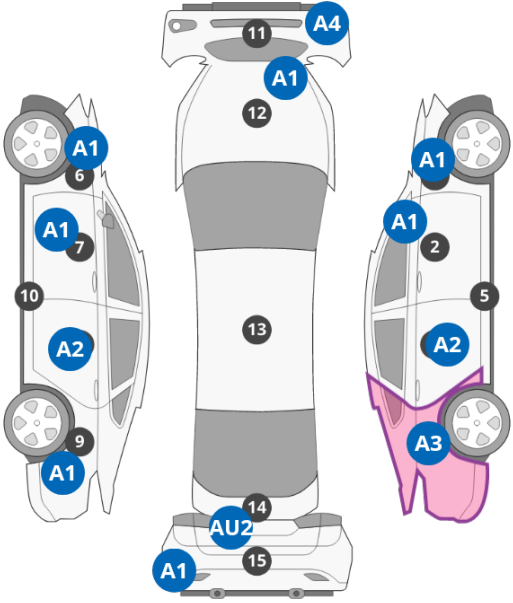
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	103	107	109
2	Boot Lid	102.3	100	101	106
3	Roof	94.4	96	96	94/92
4	Left Front Fender	96.3	96	97	97
5	Left Front Door	99.0	100	103	94
6	Center Panel Left				
7	Left Rear Door	103.7	98	103	110
8	Left Back Panel	105.1	113	104	98
9	Right Front Fender	98.8	102	93	101
10	Right Front Door	97.3	97	99	97
11	Center Panel Right				
12	Right Rear Door	101.6	104	100	101
13	Right Back Panel	289.0	153	478	236

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with jack No tools/with reverse camera/with warranty booklet/with spare key</p>