

General Information

Date & Time: 09, Sep, 2025 09:53

Make	Mitsubishi	Model	Pajero
YOM	2012	Odo Meter Reading	79,256
Registration No.	UUI680	Chassis No.	JMYLYV97WCJ000178
CC	3.8	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



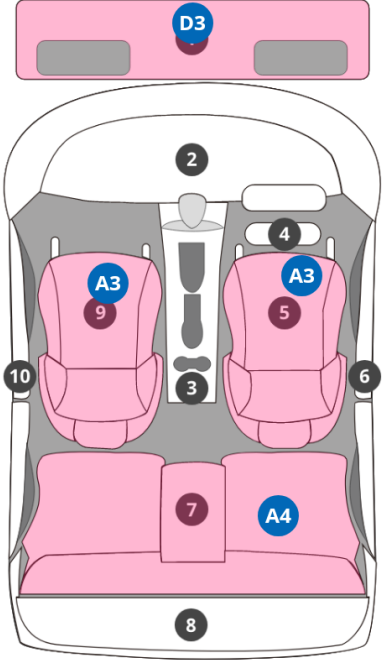
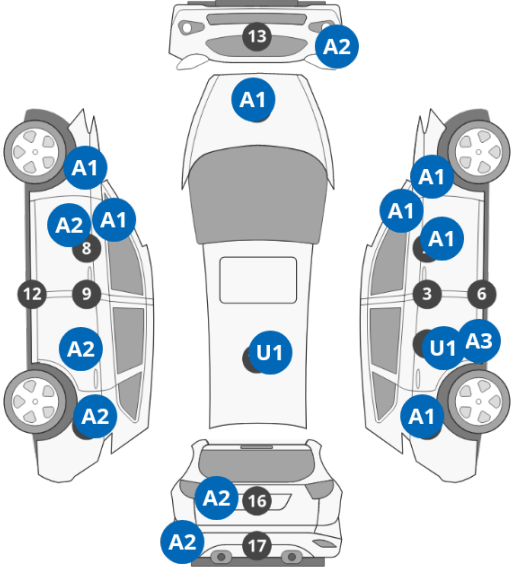
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	78.2	73	75	87
2	Boot Lid	115.3	101	126	119
3	Roof	126.7	139	127	127/114
4	Left Front Fender	131.0	123	149	121
5	Left Front Door	130.0	133	132	125
6	Center Panel Left				
7	Left Rear Door	127.3	121	114	147
8	Left Back Panel	137.6	158	131	124
9	Right Front Fender	132.3	122	151	124
10	Right Front Door	146.0	150	147	141
11	Center Panel Right				
12	Right Rear Door	140.3	144	136	141
13	Right Back Panel	150.3	144	145	162

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Ceiling - Crinkle - Medium / (R) Front Seat - Cut, Crack - Medium / (L) Front Seat - Cut, Crack - Medium / Rear Seat - Cut, Crack - Large</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light and headlight, suncrack tail light and headlight, brake lights issue,</p>