

General Information

Date & Time: 08, Sep, 2025 08:52

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	34,395
Registration No.	NGS8974	Chassis No.	PA1B18F30M4134578
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



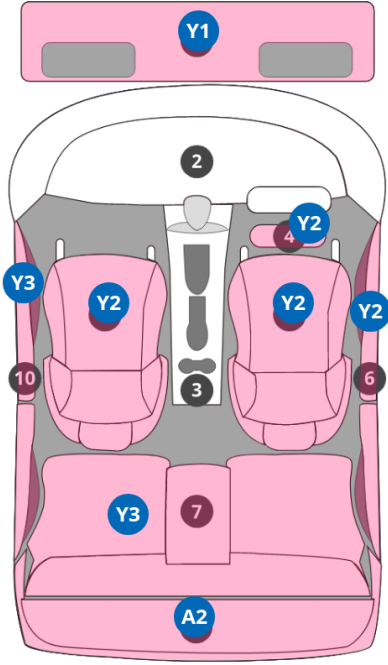
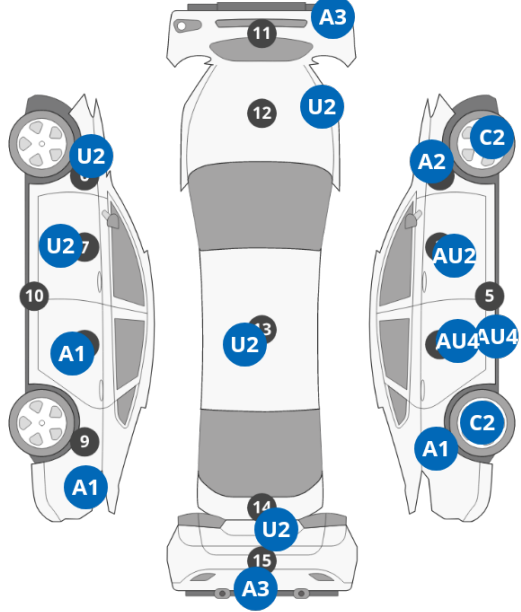
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	110	107	107
2	Boot Lid	103.3	103	100	107
3	Roof	93.1	97	86	91/99
4	Left Front Fender	102.1	89	100	117
5	Left Front Door	103.4	109	105	96
6	Center Panel Left				
7	Left Rear Door	106.7	112	110	98
8	Left Back Panel	110.0	117	101	112
9	Right Front Fender	138.3	133	137	145
10	Right Front Door	98.8	97	94	105
11	Center Panel Right				
12	Right Rear Door	103.3	104	108	98
13	Right Back Panel	102.1	93	98	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Dent - Small / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Roof - Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No reverse camera/No spare key/No warranty booklet/plate light issue/with jack/ No tools</p>