

General Information

Date & Time: 08, Sep, 2025 16:34

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	98,497
Registration No.	DBJ7483	Chassis No.	PA1B18F3XP4225474
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



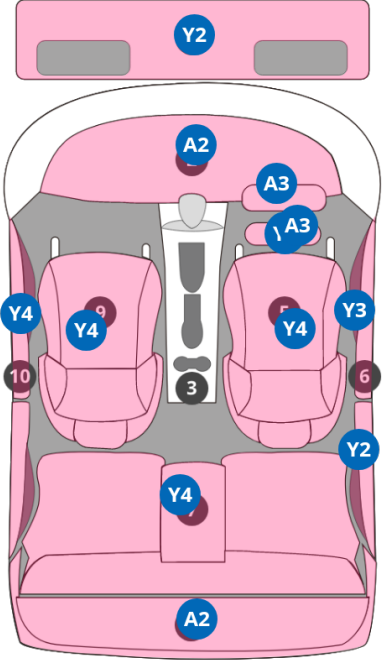
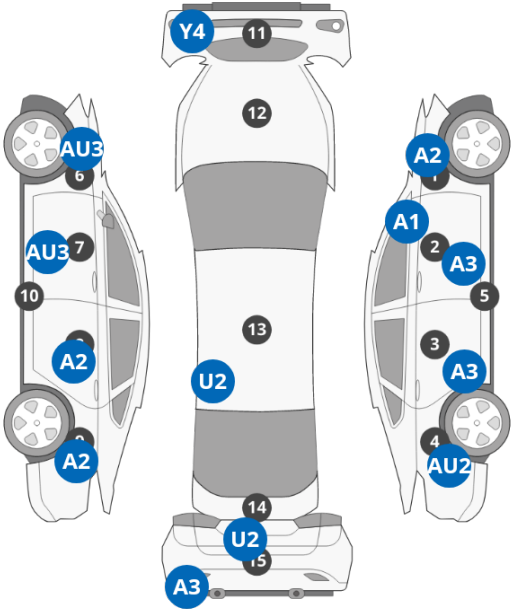
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.4	106	100	98
2	Boot Lid	95.3	90	98	98
3	Roof	90.7	94	90	87/92
4	Left Front Fender	95.9	97	96	95
5	Left Front Door	98.3	97	101	97
6	Center Panel Left				
7	Left Rear Door	96.2	98	90	101
8	Left Back Panel	102.0	109	100	97
9	Right Front Fender	101.6	100	104	101
10	Right Front Door	99.6	97	102	100
11	Center Panel Right				
12	Right Rear Door	97.2	97	96	99
13	Right Back Panel	93.0	84	96	100

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / Mat Other - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Large / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Floor Mat - Cut, Crack - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No reverse camera/parking light issue/ with jack No tools/with warranty booklet/possible flooding/foul smell/rear seats issue/front left and right seats dirty</p>