

General Information

Date & Time: 09, Sep, 2025 10:51

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	46,875
Registration No.	DBN5772	Chassis No.	PA1B18F39P4232609
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



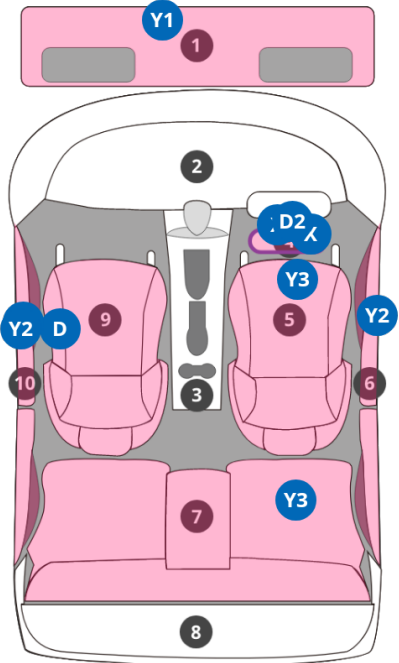
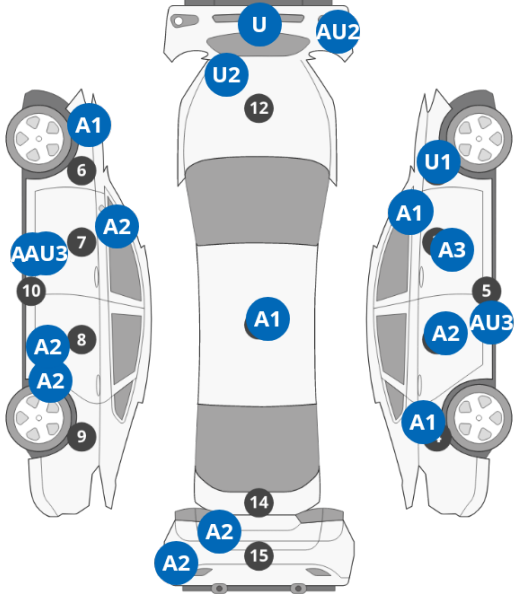
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.3	161	115	118
2	Boot Lid	112.0	106	115	115
3	Roof	108.2	103	121	106/103
4	Left Front Fender	104.6	100	105	109
5	Left Front Door	110.0	111	115	104
6	Center Panel Left				
7	Left Rear Door	104.2	109	105	99
8	Left Back Panel	109.0	117	109	101
9	Right Front Fender	177.3	178	176	178
10	Right Front Door	116.3	149	101	99
11	Center Panel Right				
12	Right Rear Door	197.6	187	198	208
13	Right Back Panel	267.3	431	203	168

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / Mat Other - Missing - Yes / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Minimal / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Dent - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack, incomplete tools, no spare tire, with LTO plate, scratches on tail light, deformed trunk floorbed cover</p>