

General Information

Date & Time: 10, Sep, 2025 08:19

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	120,707
Registration No.	NHN2845	Chassis No.	PA1B18F36P4236570
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



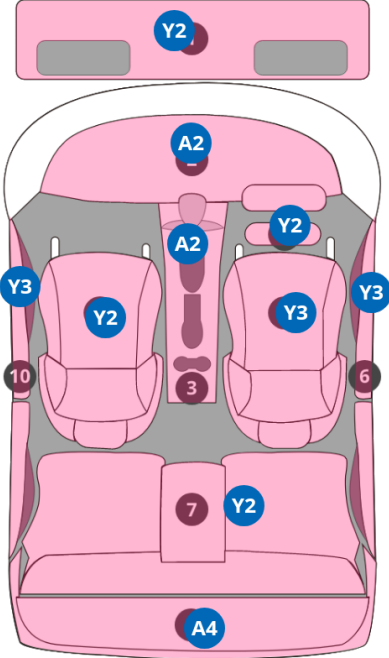
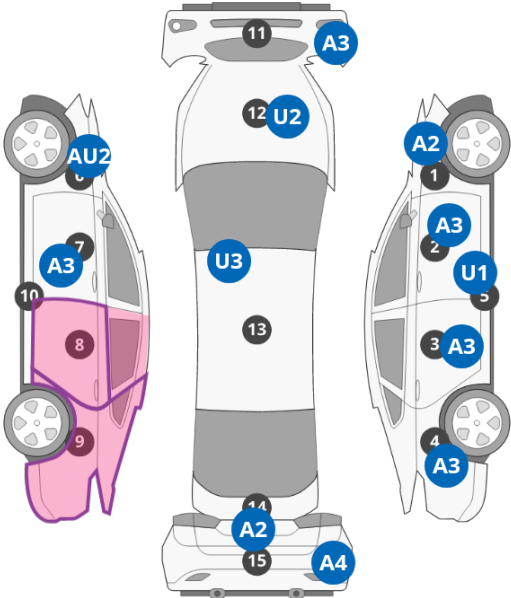
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.6	102	106	100
2	Boot Lid	98.5	96	99	100
3	Roof	89.7	91	88	92/89
4	Left Front Fender	96.4	97	93	100
5	Left Front Door	97.3	101	91	100
6	Center Panel Left				
7	Left Rear Door	330.6	262	452	278
8	Left Back Panel	527.3	1,133	246	203
9	Right Front Fender	98.9	101	96	100
10	Right Front Door	98.4	98	100	98
11	Center Panel Right				
12	Right Rear Door	100.6	104	95	103
13	Right Back Panel	98.0	95	94	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Large / Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Difference in Color / (L) Rear Door, Molding - Repair mark - Difference in Color / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Dent - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / Roof - Dent - Medium / (L) Front Door, Molding - Scratch - Medium / Bonnet, Headlight - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with reverse camera/No warranty booklet/left side rear door window issue/left side rear fender issue/trunk door issue/No jack and tools/radiator cover missing</p>