

General Information

Date & Time: 09, Sep, 2025 12:58

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	79,531
Registration No.	NIN6302	Chassis No.	PA1B18F34P4209447
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



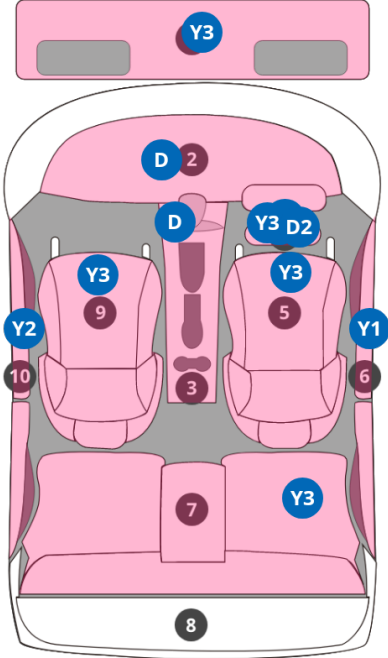
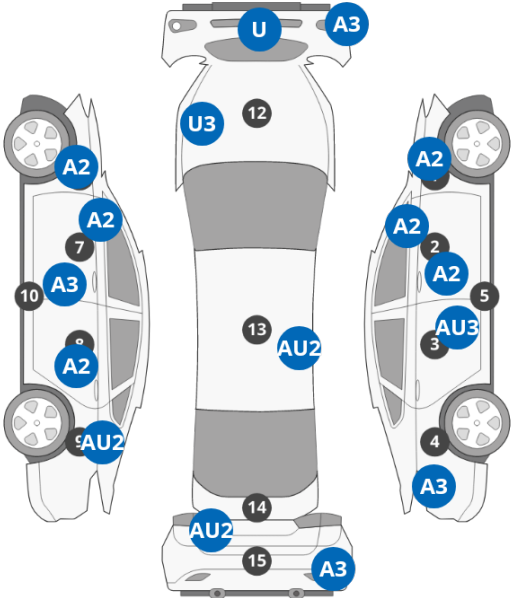
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	116	108	118
2	Boot Lid	115.0	116	109	120
3	Roof	109.2	113	110	106/108
4	Left Front Fender	103.0	102	105	102
5	Left Front Door	109.5	105	125	99
6	Center Panel Left				
7	Left Rear Door	108.6	112	107	107
8	Left Back Panel	120.3	126	111	124
9	Right Front Fender	105.6	107	108	102
10	Right Front Door	101.8	109	99	98
11	Center Panel Right				
12	Right Rear Door	112.3	104	104	129
13	Right Back Panel	107.6	105	108	110

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Grime - Large / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Small / Ceiling - Grime - Medium / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, possible flooding, plate light issue</p>