

General Information

Date & Time: 08, Sep, 2025 14:52

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	45,920
Registration No.	NIR8844	Chassis No.	PA1B18F32P4226800
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



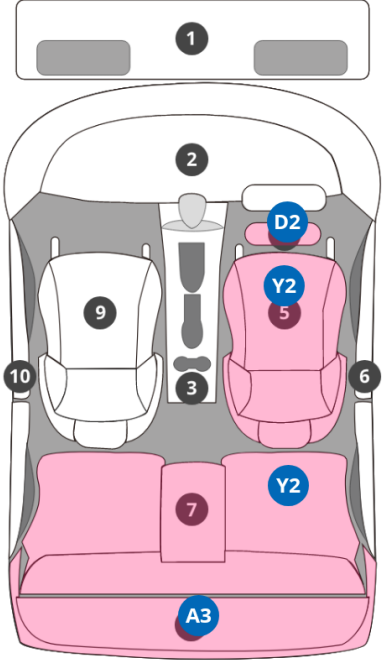
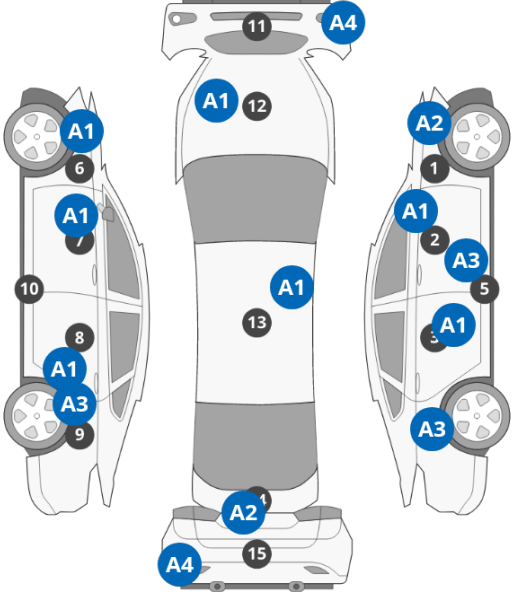
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.2	117	100	111
2	Boot Lid	119.0	120	104	133
3	Roof	98.9	108	98	96/94
4	Left Front Fender	108.1	110	98	117
5	Left Front Door	106.6	105	104	111
6	Center Panel Left				
7	Left Rear Door	110.6	111	108	113
8	Left Back Panel	106.0	109	102	107
9	Right Front Fender	103.1	108	98	104
10	Right Front Door	103.3	104	102	104
11	Center Panel Right				
12	Right Rear Door	113.3	116	110	114
13	Right Back Panel	116.3	117	111	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, with jack, no tools, with spare tire, irregular VS form</p>