

## General Information

Date & Time: 09, Sep, 2025 14:59

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	9,037
<b>Registration No.</b>	NJA2805	<b>Chassis No.</b>	PA1B18F39S4281737
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



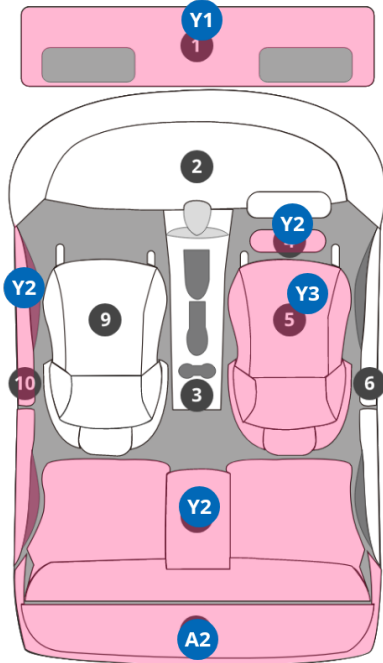
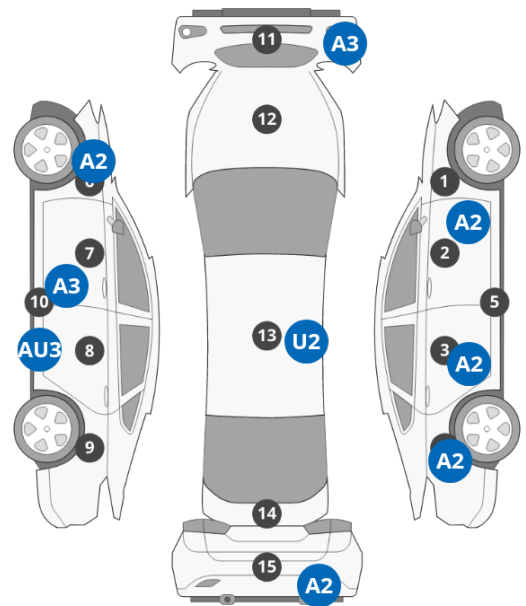
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	112	114	104
2	Boot Lid	99.7	98	106	95
3	Roof	103.9	107	98	115/96
4	Left Front Fender	95.1	98	91	97
5	Left Front Door	106.3	101	104	114
6	Center Panel Left				
7	Left Rear Door	99.0	98	102	97
8	Left Back Panel	99.2	101	100	97
9	Right Front Fender	101.7	104	95	106
10	Right Front Door	159.3	100	104	274
11	Center Panel Right				
12	Right Rear Door	101.7	98	103	104
13	Right Back Panel	97.9	95	106	93

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with spare key/No jack and tools/No warranty booklet/with reverse camera/Left side tail light cover small crack/trunk room carpet missing</p>