

General Information

Date & Time: 09, Sep, 2025 13:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	29,625
Registration No.	NKD8963	Chassis No.	PA1B18F38R4252627
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



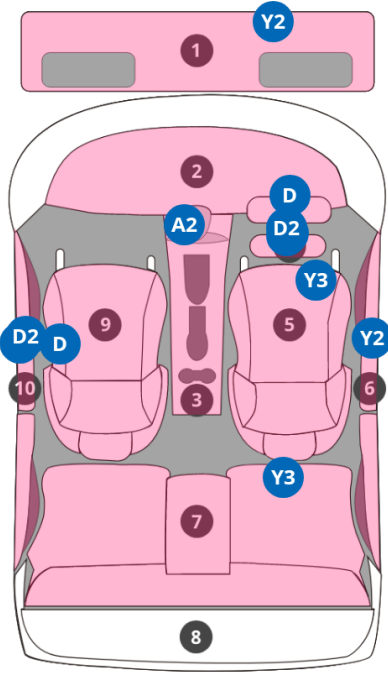
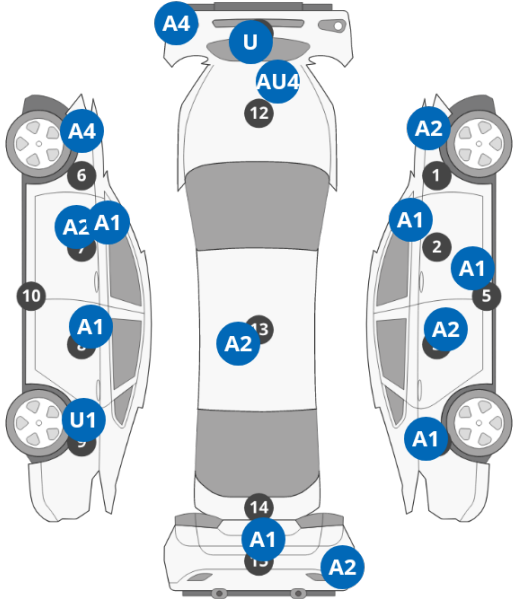
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	113	114	123
2	Boot Lid	110.0	119	106	105
3	Roof	100.1	105	103	95/98
4	Left Front Fender	104.6	107	105	102
5	Left Front Door	104.6	108	103	103
6	Center Panel Left				
7	Left Rear Door	107.6	124	103	96
8	Left Back Panel	113.6	124	113	104
9	Right Front Fender	99.6	102	97	100
10	Right Front Door	100.9	103	98	102
11	Center Panel Right				
12	Right Rear Door	105.6	98	113	106
13	Right Back Panel	103.6	100	101	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Cut, Crack - Small / (R) Front Floor Mat - Worked - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Large / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Large / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light</p>