

General Information

Date & Time: 10, Sep, 2025 12:44

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	63,866
Registration No.	DAP9904	Chassis No.	PA1B18F32N4173173
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



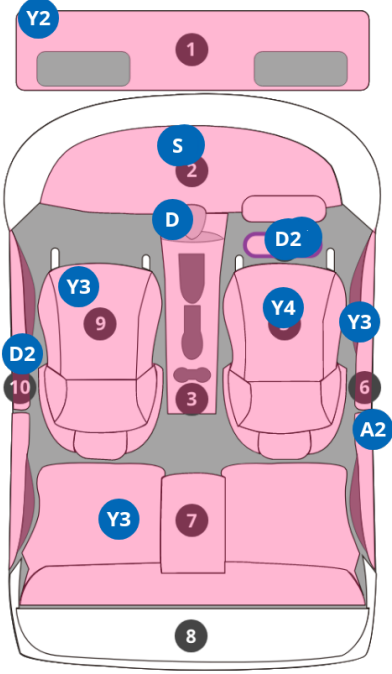
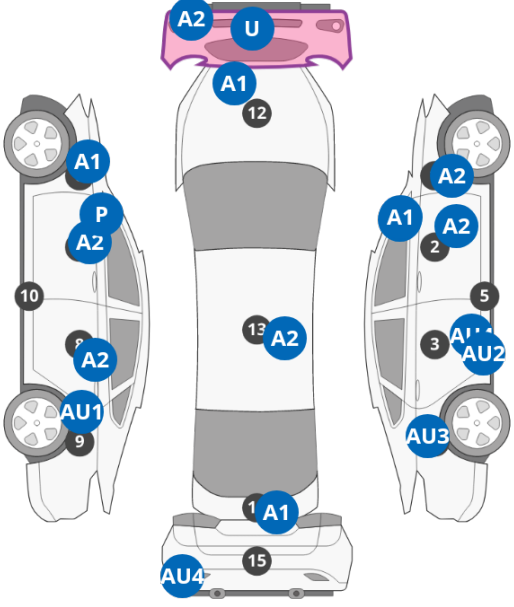
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	116	106	114
2	Boot Lid	104.5	98	99	117
3	Roof	104.8	112	106	94/107
4	Left Front Fender	263.0	192	269	328
5	Left Front Door	128.0	122	135	127
6	Center Panel Left				
7	Left Rear Door	107.3	115	105	102
8	Left Back Panel	119.6	128	125	106
9	Right Front Fender	170.6	171	139	202
10	Right Front Door	97.5	102	95	96
11	Center Panel Right				
12	Right Rear Door	104.1	104	97	111
13	Right Back Panel	99.8	99	99	102

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (R) Rear Trim - Cut, Crack - Small / (R) Front Trim - Grime - Medium / Overall Interior - Animal Hair - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / Ceiling - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Mirror - Crack - Damaged / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, room lamp issue</p>