

General Information

Date & Time: 24, Feb, 2026 17:11

Make	Toyota	Model	Avanza
YOM	2020	Odo Meter Reading	57,460
Registration No.	NFY6596	Chassis No.	MHKM5EF2FLK024133
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



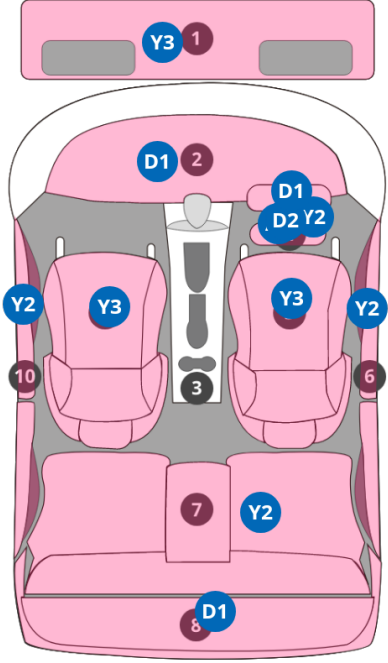
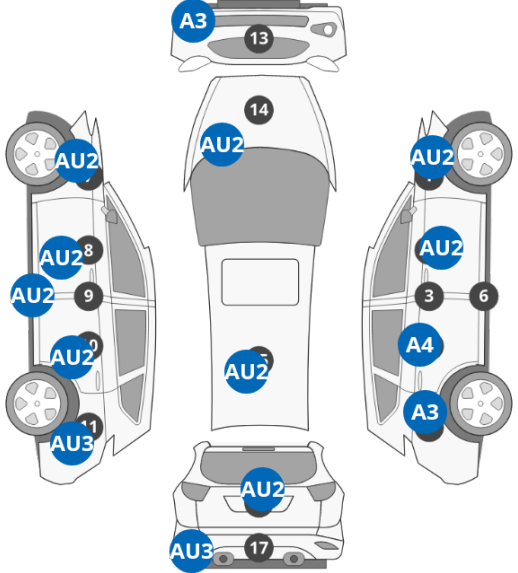
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	110	103	115
2	Boot Lid	114.6	114	115	115
3	Roof	104.3	93	102	116/107
4	Left Front Fender	116.6	110	125	115
5	Left Front Door	109.3	111	110	107
6	Center Panel Left				
7	Left Rear Door	109.0	109	112	106
8	Left Back Panel	103.0	106	103	100
9	Right Front Fender	117.6	115	132	106
10	Right Front Door	119.0	129	121	107
11	Center Panel Right				
12	Right Rear Door	107.0	101	112	108
13	Right Back Panel	105.0	105	104	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Medium / Dashboard - Worked - Minimal / Mat Other - Worked - Small / Glove Box - Worked - Minimal / Trunk Room - Worked - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, scratches on taillight and headlight, with spare tire, with jack and incomplete tools, no spare key, no warranty and manual booklet,,no reverse camera.</p>