

General Information

Date & Time: 08, Sep, 2025 15:09

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	30,371
Registration No.	DAQ4941	Chassis No.	JTFJT02P6M0015041
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



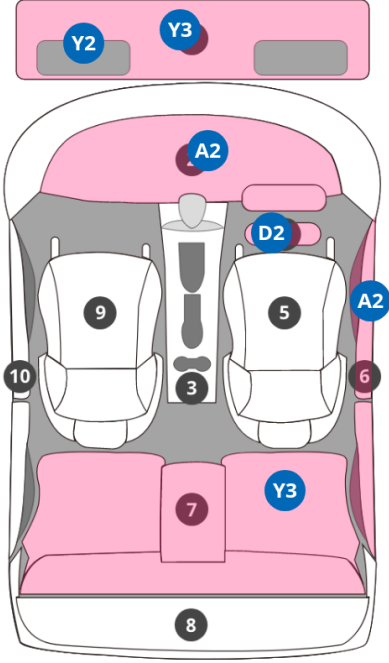
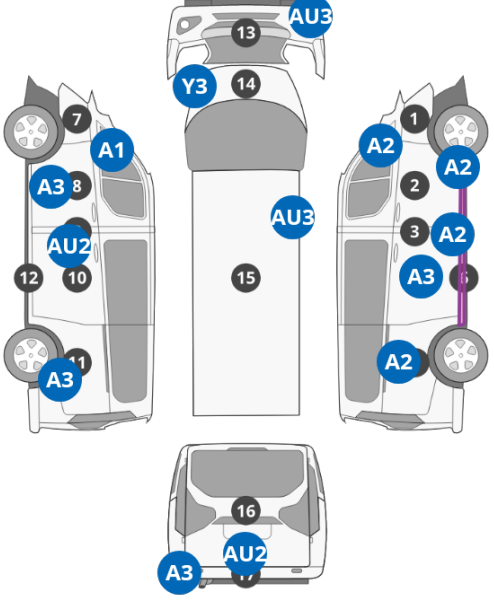
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	166.3	152	155	192
2	Boot Lid	97.1	94	100	97
3	Roof	84.6	98	92	74/74
4	Left Front Fender	148.0	150	159	135
5	Left Front Door	92.5	86	94	98
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	91.7	97	86	93
9	Right Front Fender	243.6	375	192	164
10	Right Front Door	155.0	154	158	153
11	Center Panel Right	123.1	108	96	165
12	Right Rear Door	151.6	141	159	155
13	Right Back Panel	97.8	99	100	95

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / (R) Front Trim - Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Sunvisor, Sunglass Holder - Grime - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / Front Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / Front Panel - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light and headlight, cracked headlight,</p>