

General Information

Date & Time: 08, Sep, 2025 14:52

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	43,582
Registration No.	DBP6047	Chassis No.	PA1B18F37R4264737
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



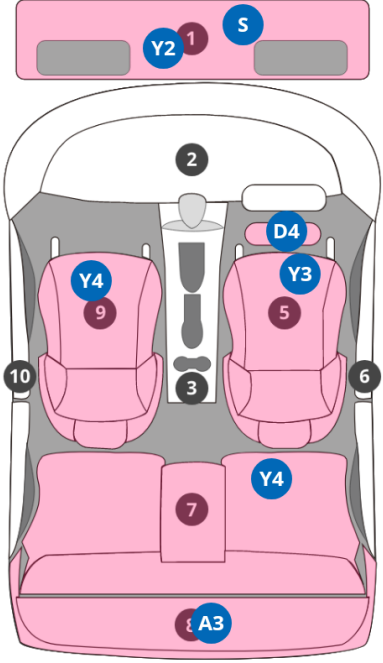
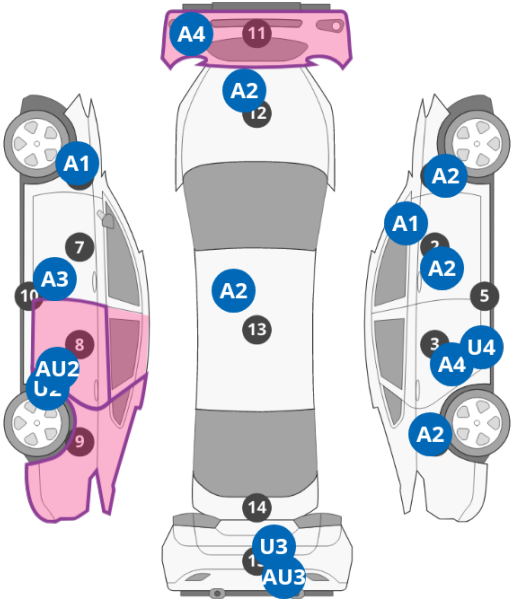
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	123	108	124
2	Boot Lid	116.0	117	109	122
3	Roof	112.0	117	114	108/109
4	Left Front Fender	103.8	102	97	113
5	Left Front Door	111.6	113	104	118
6	Center Panel Left				
7	Left Rear Door	110.6	114	108	110
8	Left Back Panel	115.6	128	115	104
9	Right Front Fender	105.7	114	95	108
10	Right Front Door	113.0	119	105	115
11	Center Panel Right				
12	Right Rear Door	107.3	100	101	121
13	Right Back Panel	112.0	112	105	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Large / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, no jack and tools, with spare tire</p>