

General Information

Date & Time: 09, Sep, 2025 07:53

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	56,155
Registration No.	NHJ3974	Chassis No.	PA1B18F30P4215245
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



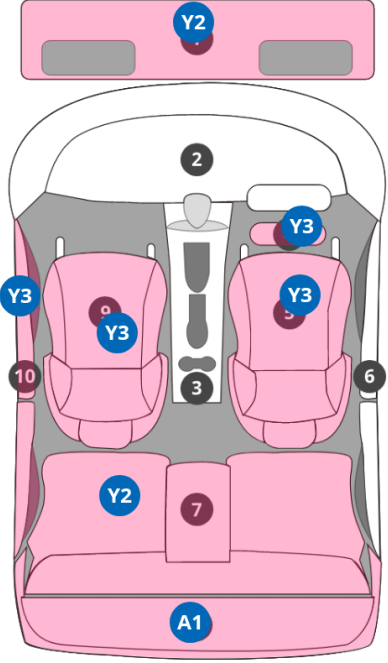
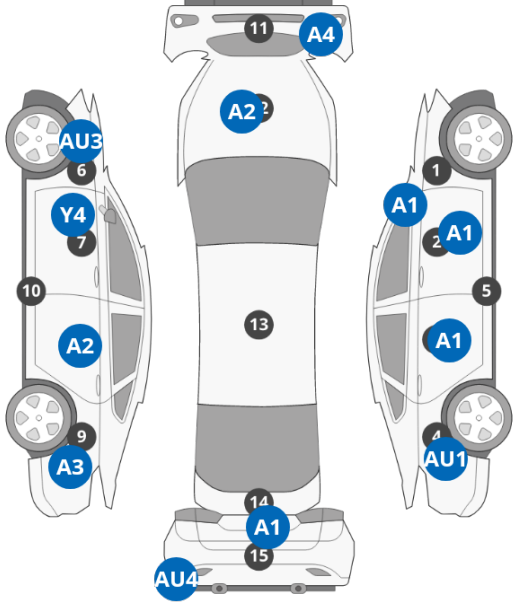
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.8	97	111	104
2	Boot Lid	102.3	99	109	99
3	Roof	90.1	91	94	85/91
4	Left Front Fender	97.8	97	97	100
5	Left Front Door	90.7	93	86	94
6	Center Panel Left				
7	Left Rear Door	94.4	100	94	89
8	Left Back Panel	111.0	122	113	98
9	Right Front Fender	93.7	91	95	95
10	Right Front Door	87.6	84	78	101
11	Center Panel Right				
12	Right Rear Door	126.6	122	119	139
13	Right Back Panel	136.6	116	131	163

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Crack, Gap - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/No spare tire/No reverse camera/No jack and tools/fuel cover tank issue/Left side cheek light missing/Trunk room switch cable issue//with warranty booklet/No spare key/left side tail light cover medium crack</p>