

General Information

Date & Time: 08, Sep, 2025 13:21

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	90,822
Registration No.	NIM6655	Chassis No.	PA1B18F35P4213555
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



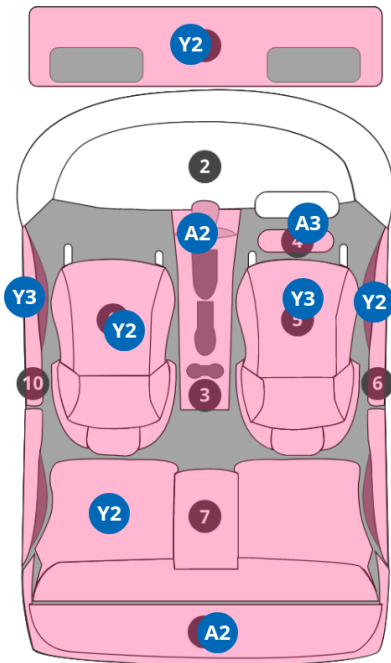
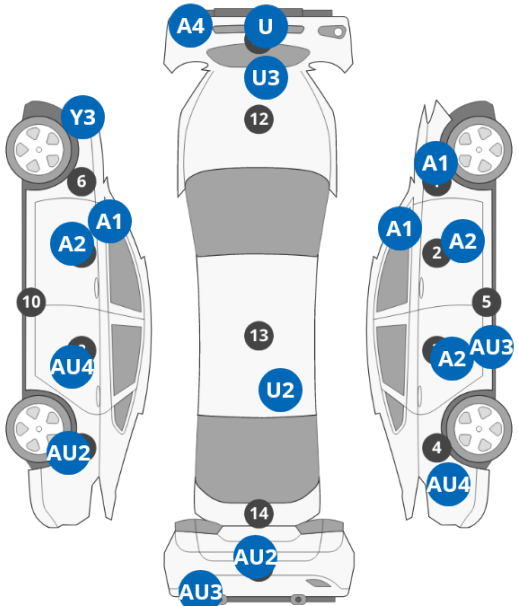
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	115	107	104
2	Boot Lid	109.0	105	107	115
3	Roof	102.5	101	104	103/102
4	Left Front Fender	101.6	100	100	105
5	Left Front Door	106.3	110	100	109
6	Center Panel Left				
7	Left Rear Door	104.0	109	101	102
8	Left Back Panel	113.3	122	115	103
9	Right Front Fender	107.0	116	103	102
10	Right Front Door	104.3	103	104	106
11	Center Panel Right				
12	Right Rear Door	103.6	100	100	111
13	Right Back Panel	109.3	113	97	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / Ceiling - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Dent - Medium / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No reverse camera/No spare key/with jack and tools/with warranty booklet/front bumper traces of bending /plate light issue</p>