

General Information

Date & Time: 03, Dec, 2024 18:34

Make	Toyota	Model	Wigo
YOM	2022	Mileage	43,248
Registration No.	CAX5246	Chassis No.	MHKA4DF5FNJ066251
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



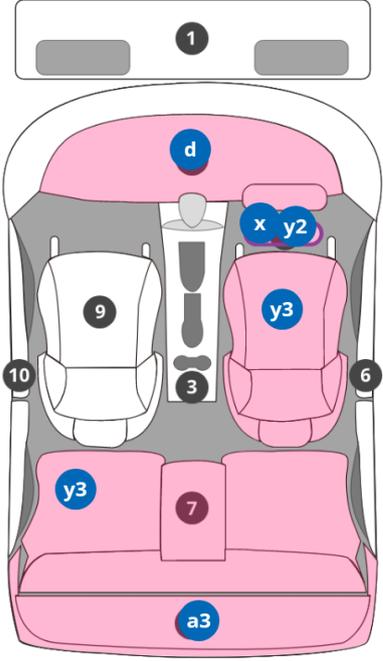
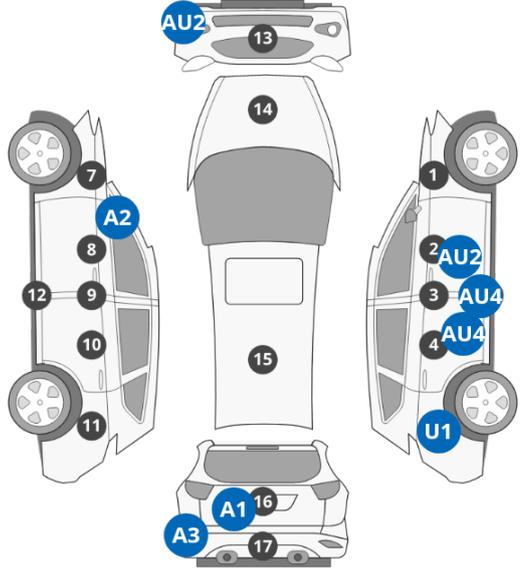
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.8	95	96	84
2	Boot Lid	91.7	91	95	89
3	Roof	89.0	82	87	97/90
4	Left Front Fender	90.2	90	92	89
5	Left Front Door	87.5	89	89	85
6	Center Panel Left				
7	Left Rear Door	87.9	84	84	96
8	Left Back Panel	85.2	87	89	80
9	Right Front Fender	96.2	95	100	94
10	Right Front Door	85.0	84	85	87
11	Center Panel Right				
12	Right Rear Door	85.6	86	85	86
13	Right Back Panel	85.8	89	82	87

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Missing - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (R) Front Seat - Grime - Medium</p>	<p>Remarks (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>swirlmarks and hairline scratches around the exterior. without warranty booklet, user manual and tools.</p>