

General Information

Date & Time: 24, Feb, 2026 16:35

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	22,788
Registration No.	NFD9673	Chassis No.	PA1B18F31N4174749
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



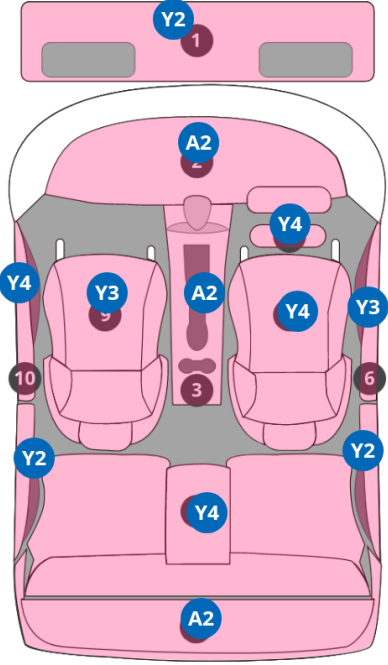
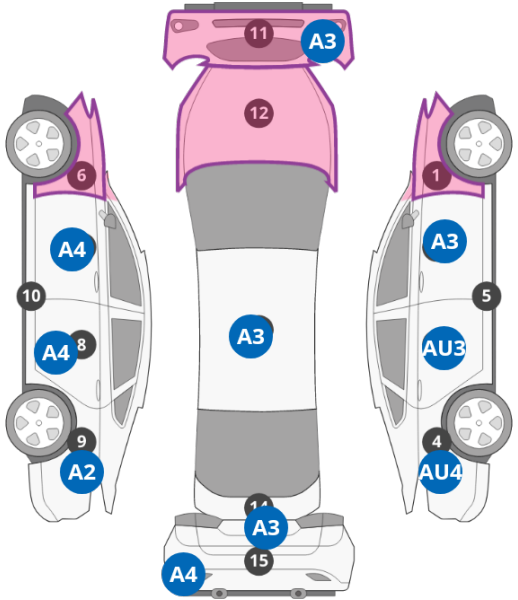
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	282.3	277	274	296
2	Boot Lid	105.3	101	104	111
3	Roof	91.3	91	95	87/92
4	Left Front Fender	186.3	198	196	165
5	Left Front Door	99.6	96	107	97
6	Center Panel Left				
7	Left Rear Door	104.0	107	104	101
8	Left Back Panel	105.6	114	101	102
9	Right Front Fender	321.3	484	264	216
10	Right Front Door	103.0	100	103	106
11	Center Panel Right				
12	Right Rear Door	124.3	127	135	111
13	Right Back Panel	103.3	102	102	106

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Grime - Large / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / Roof - Scratch - Medium
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Condition of Welding ? - Yes	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/with jack and incomplete tools/No seat cover/No warranty booklet/with reverse camera/cross member support traces of welding/Dome light issue/Possible flooding/front right side door issue