

General Information

Date & Time: 10, Sep, 2025 16:03

Make	Ford	Model	Escape
YOM	2012	Odo Meter Reading	117,114
Registration No.	TIS435	Chassis No.	PE2EV222C1GP00812
CC	2.3	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



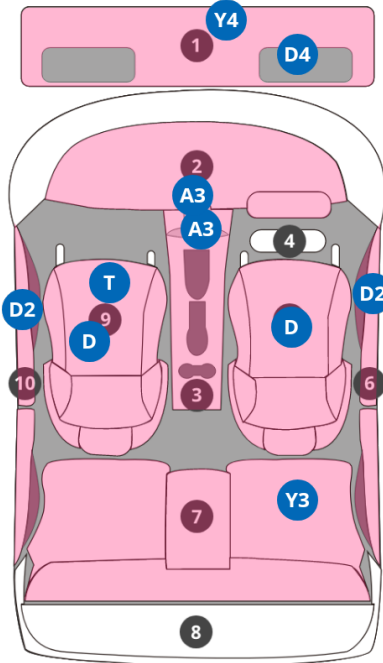
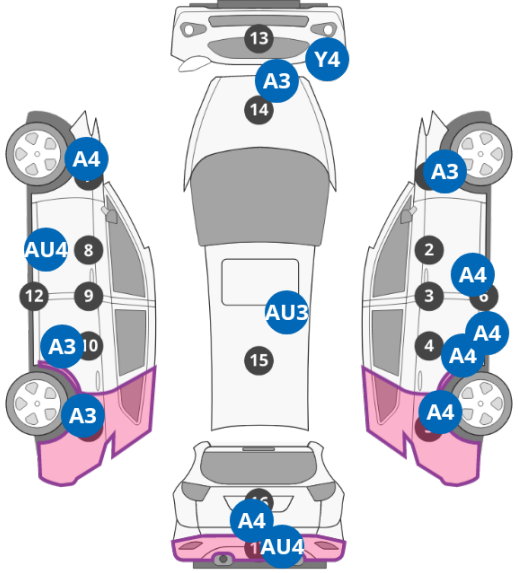
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	132.6	145	118	135
2	Boot Lid	108.5	116	114	96
3	Roof	119.5	115	120	129/114
4	Left Front Fender	114.6	116	121	107
5	Left Front Door	108.6	103	113	110
6	Center Panel Left				
7	Left Rear Door	110.0	110	115	105
8	Left Back Panel	534.0	1,276	179	147
9	Right Front Fender	111.6	101	108	126
10	Right Front Door	118.0	111	117	126
11	Center Panel Right				
12	Right Rear Door	107.4	98	110	114
13	Right Back Panel	154.3	169	136	158

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Overall Interior - Worn as per age - Yes / (L) Front Seat - Cigarette Burns - Burnt, Hole / Ceiling - Grime - Large / Switchs - Partially Missing - Yes / Switchs - Partially Missing - Yes / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Knobs - Worn, Peel, Crack - Medium / Dashboard - Worn, Scratch, Cut, Crack - Medium / Sunvisor, Sunglass Holder - Worked - Large / Rear Seat - Grime - Medium	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Front Door, Molding - Scratch - Large / Roof - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Medium / (L) Front Fender, Molding - Scratch - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium
Frame Evaluation : B	Functional Evaluation : E
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Head Light, High Beam - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no tools and jack/ front passenger window issue/ oil warning light on/ air-conditioning issue/ possible flooding/ radio not working/ abnormal engine vibration/ spongy brake pedal/ high beam issue/ wiper issue/ with LTO plate