

## General Information

Date & Time: 12, Sep, 2025 15:36

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	17,168
<b>Registration No.</b>	DBO5527	<b>Chassis No.</b>	PAEA13RXRPA017659
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



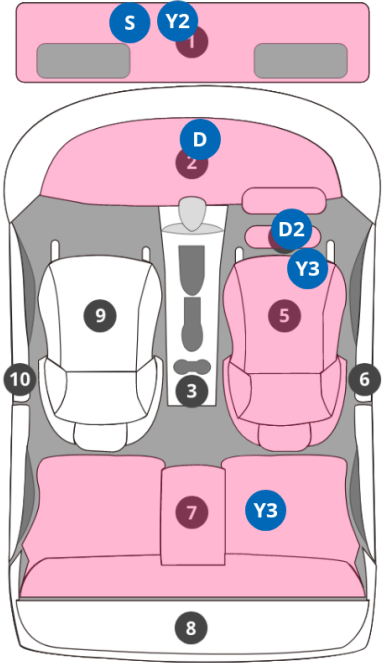
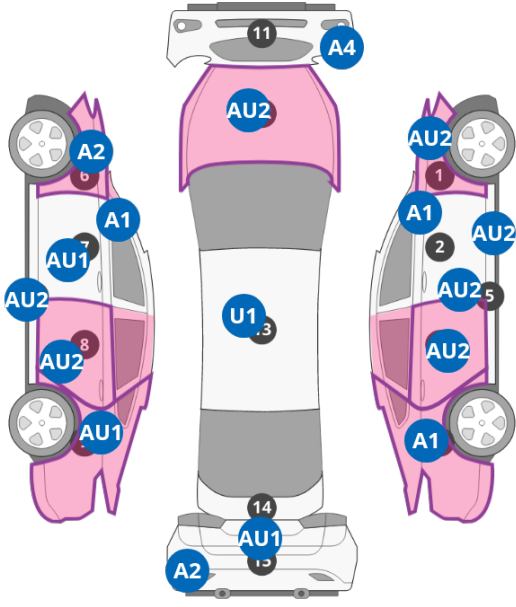
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>218.0</b>	262	205	187
2	Boot Lid	<b>141.6</b>	130	146	149
3	Roof	<b>148.5</b>	141	159	153/141
4	Left Front Fender	<b>264.3</b>	387	201	205
5	Left Front Door	<b>157.0</b>	153	159	159
6	Center Panel Left				
7	Left Rear Door	<b>187.0</b>	216	168	177
8	Left Back Panel	<b>179.3</b>	190	184	164
9	Right Front Fender	<b>210.0</b>	217	184	229
10	Right Front Door	<b>168.6</b>	171	157	178
11	Center Panel Right				
12	Right Rear Door	<b>191.3</b>	173	162	239
13	Right Back Panel	<b>191.0</b>	165	153	255

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Ceiling - Grime - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Roof - Dent - Minimal / Bonnet, Headlight - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet and Sparetire, No Tools and Jack, Scratch headlight and tail light, foul smell, No LTO PLATE.</p>