

## General Information

Date & Time: 15, Sep, 2025 10:46

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	34,200
<b>Registration No.</b>	NEV2415	<b>Chassis No.</b>	PAEA13RJMMMA020434
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



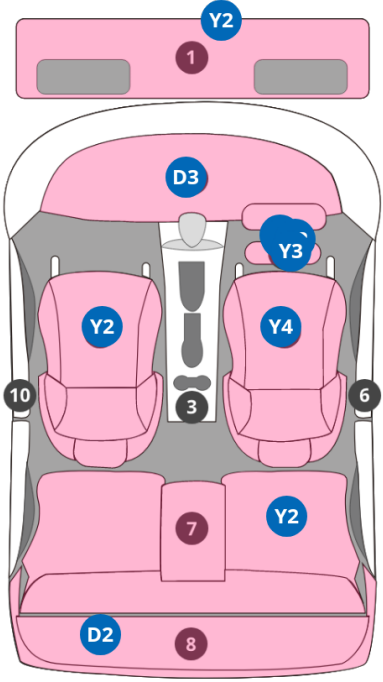
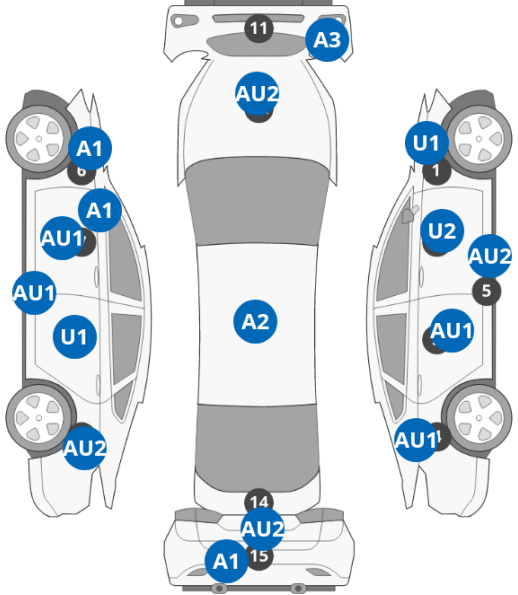
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	108	107	111
2	Boot Lid	89.5	84	95	89
3	Roof	87.0	86	86	80/96
4	Left Front Fender	114.0	117	116	109
5	Left Front Door	126.0	118	128	132
6	Center Panel Left				
7	Left Rear Door	115.6	120	107	120
8	Left Back Panel	132.3	140	131	126
9	Right Front Fender	93.4	93	92	96
10	Right Front Door	96.6	94	98	99
11	Center Panel Right				
12	Right Rear Door	95.9	92	94	102
13	Right Back Panel	123.6	128	126	117

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>C</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Small / (R) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Medium / Dashboard - Loose, Deformed - Medium / Rear Seat - Grime - Small / Trunk Room - Loose, Deformed - Small / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Dent - Minimal / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Roof - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate in front temporary plate in rear, Incomplete Tools and Sparetire, No warranty booklet and Jack, worn tires and Sparetire, foglight issue and headlight issue, foul smell, center cap missing, no spare key.</p>