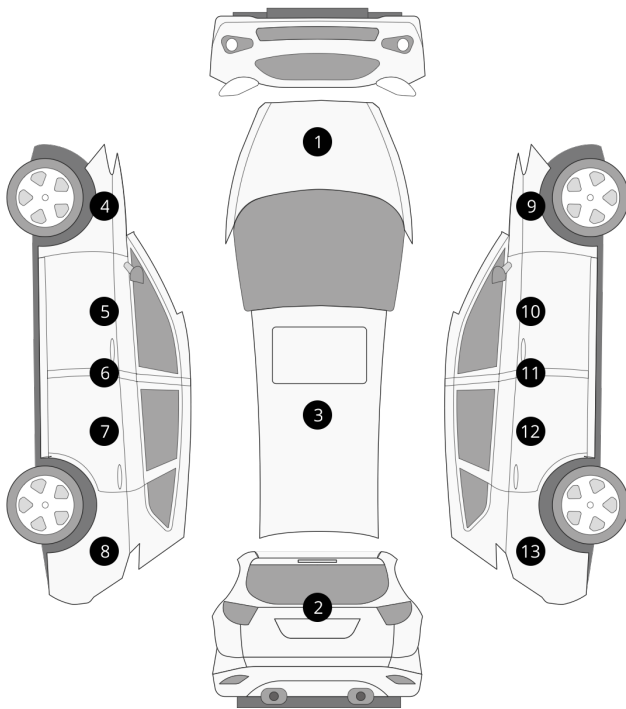


General Information

Date & Time: 11, Oct, 2025 21:27

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	39,192
Registration No.	FAF3186	Chassis No.	PA1B18F38L4130857
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



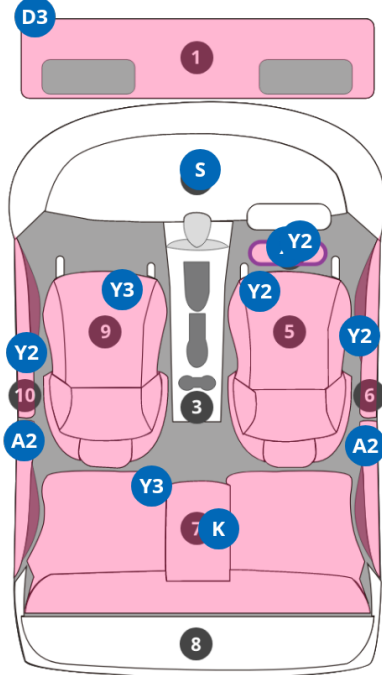
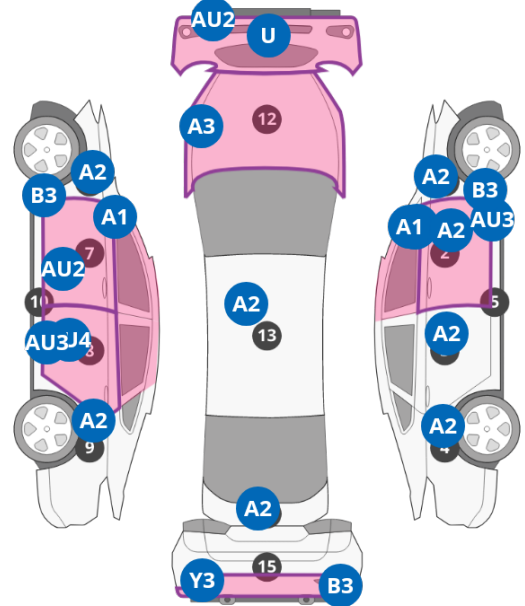
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	163.6	174	158	159
2	Boot Lid	105.5	99	101	117
3	Roof	90.0	95	84	93/88
4	Left Front Fender	85.3	82	87	87
5	Left Front Door	132.0	119	141	136
6	Center Panel Left				
7	Left Rear Door	146.0	138	132	168
8	Left Back Panel	249.3	172	443	133
9	Right Front Fender	226.0	141	143	394
10	Right Front Door	133.0	155	116	128
11	Center Panel Right				
12	Right Rear Door	95.7	100	89	98
13	Right Back Panel	216.3	218	243	188

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Small / (L) Rear Trim - Cut, Crack - Small / Mat Other - Missing - Yes / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Crinkle - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Stuck - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Modified - Medium / (R) Front Fender, Molding - Modified - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Modified - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, no jack and tools, no spare tire, with LTO plate, possible flooding, right side mirror issue, scratched and cracked tail light, loose tail light, loose/deformed trunk floormat