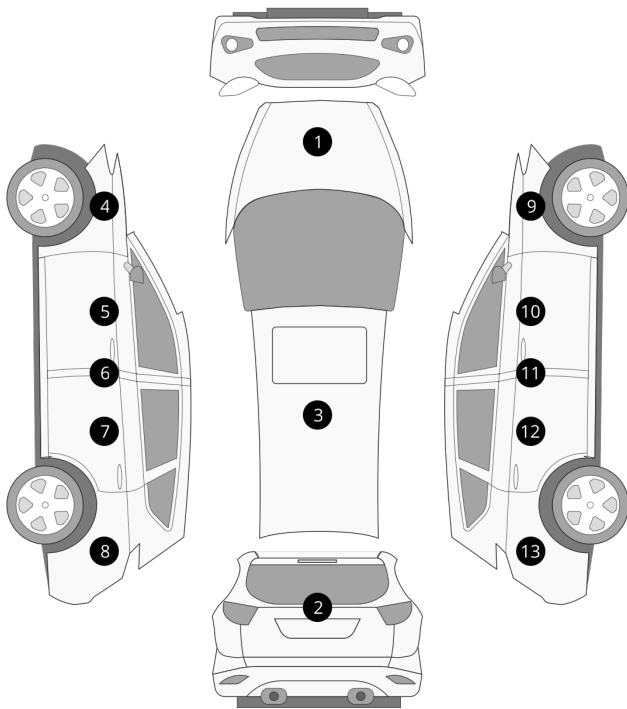


General Information

Date & Time: 10, Oct, 2025 20:43

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	35,462
Registration No.	FAI6867	Chassis No.	PA1B18F35M4162134
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



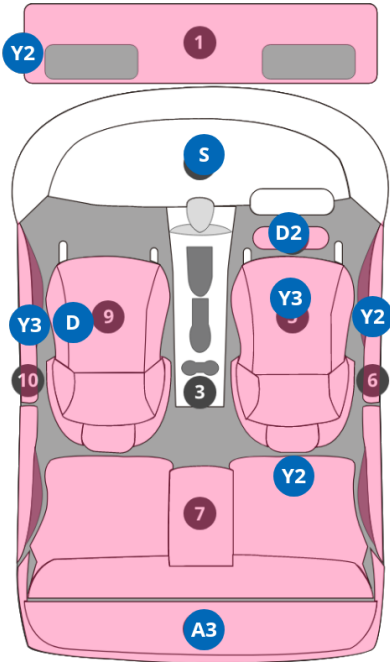
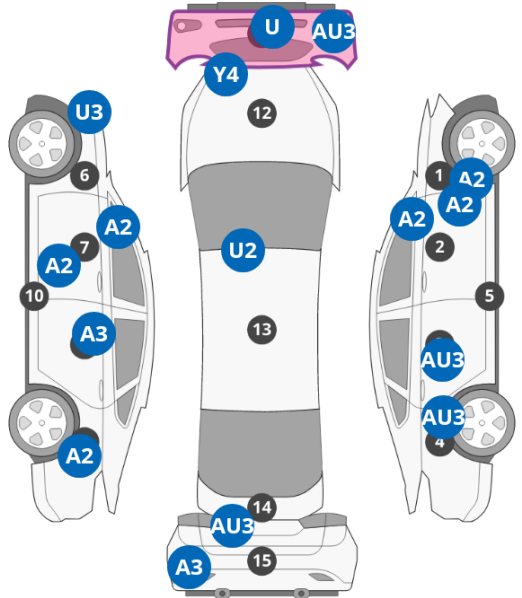
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	103	133	116
2	Boot Lid	133.6	139	158	104
3	Roof	94.3	99	89	94/96
4	Left Front Fender	101.3	117	92	95
5	Left Front Door	97.9	93	100	101
6	Center Panel Left				
7	Left Rear Door	99.3	100	100	99
8	Left Back Panel	126.3	174	101	104
9	Right Front Fender	119.3	110	123	125
10	Right Front Door	94.6	94	100	90
11	Center Panel Right				
12	Right Rear Door	93.2	90	96	93
13	Right Back Panel	94.8	103	87	94

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / Trunk Room - Worn, Scratch, Cut, Crack - Medium	Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Dent - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Dent - Small / Bonnet, Headlight - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack and incomplete tools, with spare tire, with LTO plate, possible flooding, scratches on tail light, cracked headlight,