

General Information

Date & Time: 25, Sep, 2025 15:13

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	76,816
Registration No.	FAL7946	Chassis No.	PA1B18F38L4124377
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition




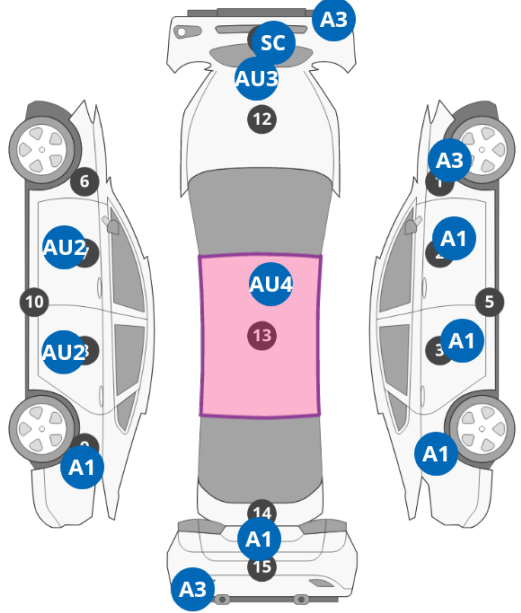
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	105	102	106
2	Boot Lid	95.5	92	94	101
3	Roof	90.3	88	82	94/97
4	Left Front Fender	92.0	91	91	94
5	Left Front Door	95.8	98	101	88
6	Center Panel Left				
7	Left Rear Door	90.8	94	91	87
8	Left Back Panel	102.6	103	104	101
9	Right Front Fender	95.3	103	94	89
10	Right Front Door	92.0	91	92	93
11	Center Panel Right				
12	Right Rear Door	100.3	101	98	102
13	Right Back Panel	106.0	104	105	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
<div style="text-align: center; background-color: #cccccc; padding: 50px;">  <p>No Image</p> </div> <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<div style="text-align: center;">  </div> <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Steering Wheel - Worn, Peel, Crack - Large / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Medium / (R) Front Trim - Grime - Medium</p>	<p>Remarks Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch & Dent - Large / Roof - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Member (Bolted) - Rust, Corrosion - Yes</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/spare tire damage/No warranty booklet/No reverse camera/No jack and tools/ high beam issue/No spare key// bonnet hood left and right traces of repair and bolted/Audio volume issue/inside the vehicle dirty</p>