

General Information

Date & Time: 10, Oct, 2025 20:40

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	19,232
Registration No.	FAN7646	Chassis No.	PA1B18F34N4195305
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



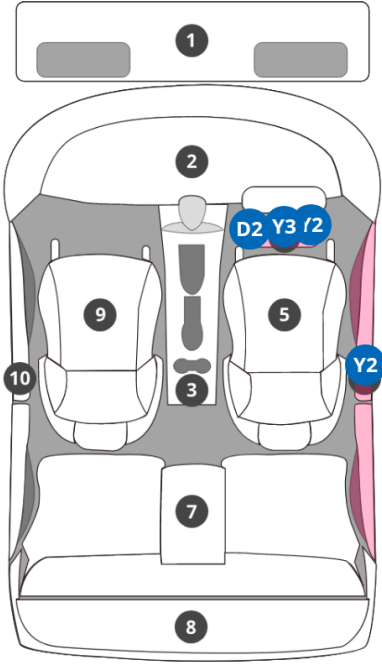
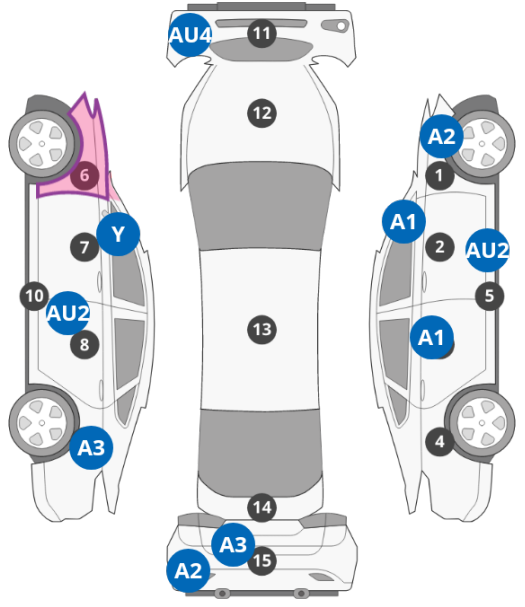
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.6	100	99	103
2	Boot Lid	92.4	95	87	96
3	Roof	86.7	88	87	82/90
4	Left Front Fender	235.6	137	397	173
5	Left Front Door	96.4	94	98	97
6	Center Panel Left				
7	Left Rear Door	92.8	100	88	91
8	Left Back Panel	101.0	101	99	103
9	Right Front Fender	91.8	89	91	96
10	Right Front Door	88.7	90	90	86
11	Center Panel Right				
12	Right Rear Door	94.0	91	99	92
13	Right Back Panel	91.3	89	87	98

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / Mat Other - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Mirror - Crack - Damaged / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Crack left taillight. Taillight issue. Left side mirror loose. Toe hook cover missing. 1 key. Without warranty booklet,jack and tools. With spare tire and seat cover. No LTO plate.