

General Information

Date & Time: 11, Oct, 2025 21:30

Make	Toyota	Model	Lite Ace
YOM	2023	Odo Meter Reading	15,157
Registration No.	FAO8824	Chassis No.	MHKU3FE10PK003803
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



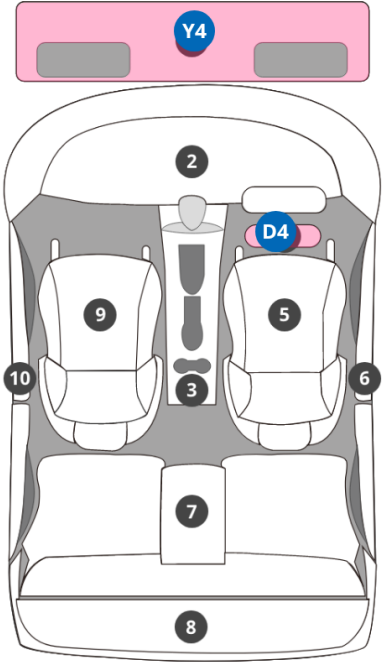
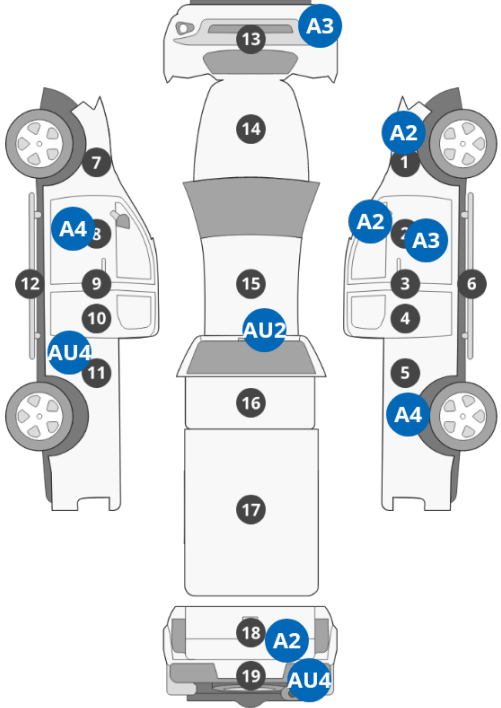
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	56.2	54	59	56
2	Boot Lid	58.0	77	45	53
3	Roof	46.1	44	52	42/47
4	Left Front Fender	43.0	41	41	48
5	Left Front Door	52.4	54	55	48
6	Center Panel Left	63.1	64	62	63
7	Left Rear Door				
8	Left Back Panel	65.0	63	62	70
9	Right Front Fender	55.7	54	54	60
10	Right Front Door	56.5	52	53	65
11	Center Panel Right	56.5	57	53	60
12	Right Rear Door				
13	Right Back Panel	63.8	74	63	55

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Carpet - Worked - Large / Ceiling - Grime - Large	Remarks (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Side Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Gate - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Without warranty booklet, spare tire, jack and tools. With seat cover. 1 key. With LTO plate.