

General Information

Date & Time: 11, Oct, 2025 21:21

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	32,633
Registration No.	FAP7632	Chassis No.	PA1B18F3XP4222624
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



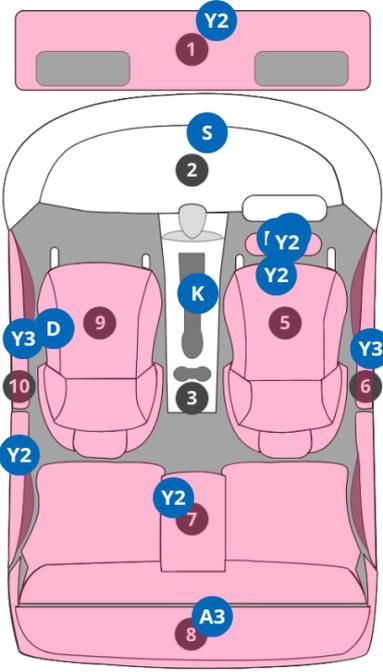
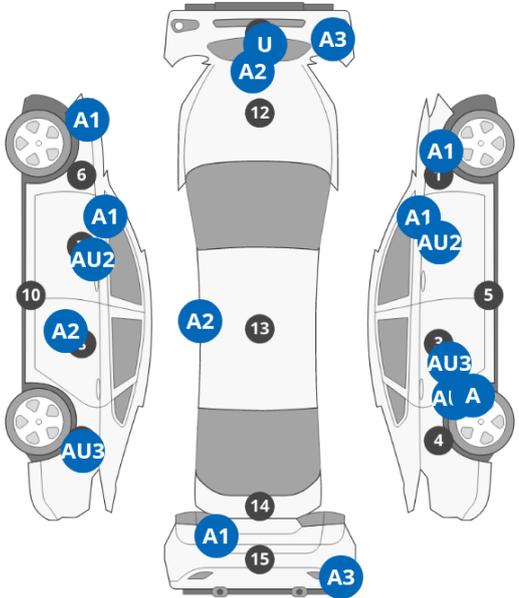
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	110	120	113
2	Boot Lid	107.6	101	112	110
3	Roof	104.0	100	96	89/131
4	Left Front Fender	103.0	100	104	105
5	Left Front Door	92.3	97	93	88
6	Center Panel Left				
7	Left Rear Door	99.7	103	98	98
8	Left Back Panel	97.5	100	97	95
9	Right Front Fender	97.4	100	92	100
10	Right Front Door	98.7	100	98	99
11	Center Panel Right				
12	Right Rear Door	98.3	97	96	102
13	Right Back Panel	101.2	104	100	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Worn - Yes / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Small / (L) Rear Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Medium / Overall Interior - Animal Hair - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Tyre - Crack, Cut - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack and tools, with spare tire, no LTO plate, scratches on tail light, possible flooding, seatbelt issue</p>