

General Information

Date & Time: 10, Oct, 2025 20:31

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	24,922
Registration No.	FAQ1156	Chassis No.	PA1B18F36P4223205
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



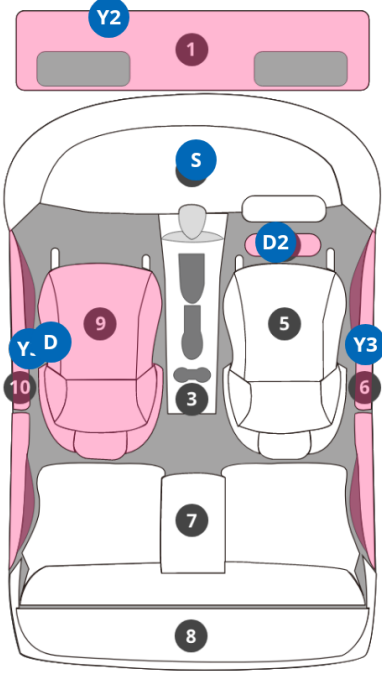
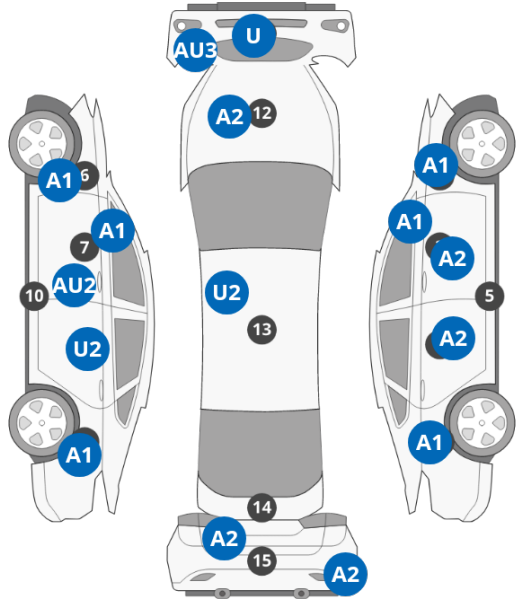
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	111	109	112
2	Boot Lid	112.6	111	117	110
3	Roof	97.1	100	105	88/96
4	Left Front Fender	103.3	101	100	109
5	Left Front Door	96.6	101	94	95
6	Center Panel Left				
7	Left Rear Door	98.5	96	98	102
8	Left Back Panel	100.5	104	99	98
9	Right Front Fender	103.3	102	103	105
10	Right Front Door	101.3	105	103	96
11	Center Panel Right				
12	Right Rear Door	102.9	98	104	107
13	Right Back Panel	108.0	105	105	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Medium / Overall Interior - Smell - Yes / (L) Front Seat - Worn - Yes / Ceiling - Grime - Small	Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, no jack and tools, with spare tire, no LTO plate, possible flooding, trunk room floormat/cover missing, scratches on tail light