

General Information

Date & Time: 23, Sep, 2025 18:56

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,311
Registration No.	FAQ4805	Chassis No.	PA1B18F37P4233421
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



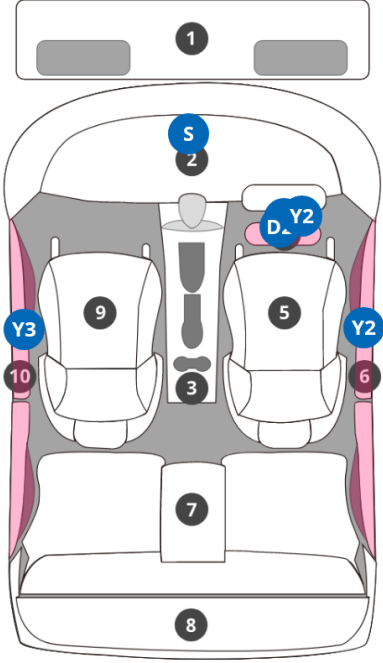
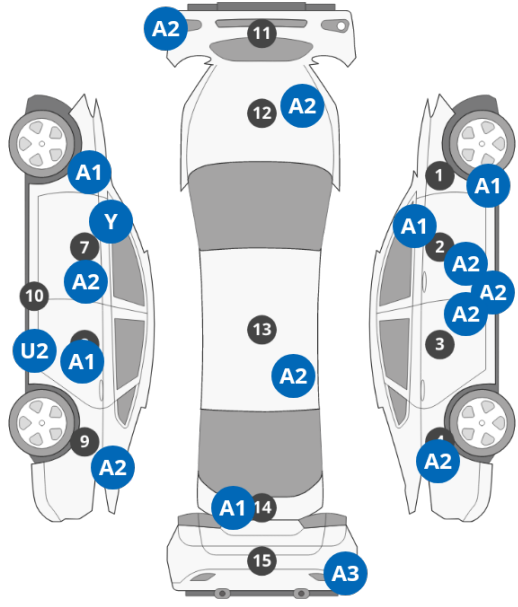
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	115	112	126
2	Boot Lid	108.6	103	105	118
3	Roof	97.2	100	103	89/97
4	Left Front Fender	99.5	99	99	101
5	Left Front Door	100.6	100	101	101
6	Center Panel Left				
7	Left Rear Door	99.7	100	103	96
8	Left Back Panel	145.0	119	120	196
9	Right Front Fender	107.3	105	115	102
10	Right Front Door	105.3	103	109	104
11	Center Panel Right				
12	Right Rear Door	100.1	94	102	104
13	Right Back Panel	104.6	106	100	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Cut, Crack - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Small / Overall Interior - Smell - Yes</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Mirror - Crack - Damaged / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack and tools, with spare tire, NO LTO PLATE, possible flooding, left side mirror issue, scratches on tail light, room and dome light issue</p>