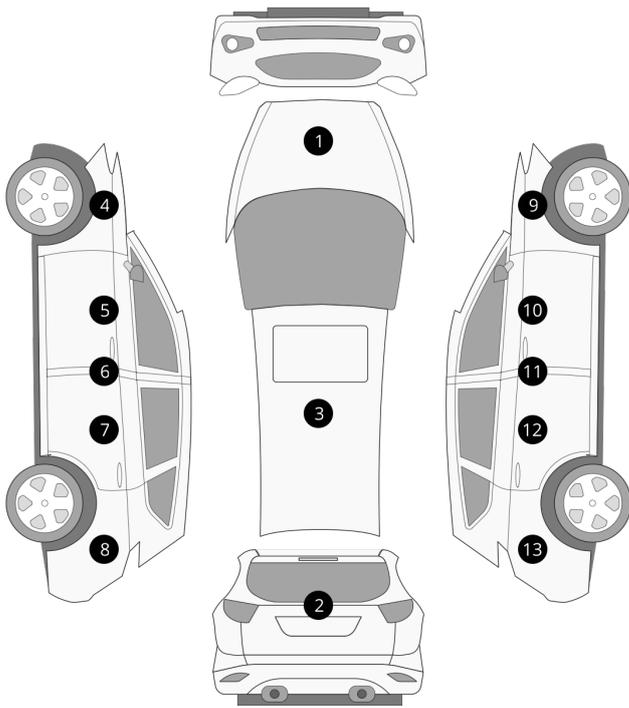


General Information

Date & Time: 18, Sep, 2025 18:43

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,430
Registration No.	FAQ5689	Chassis No.	PA1B18F35P4232929
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



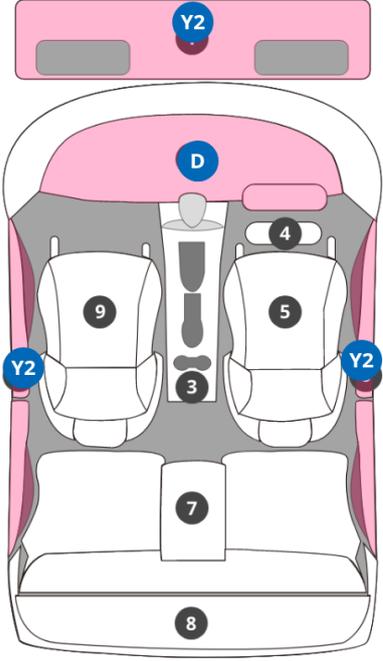
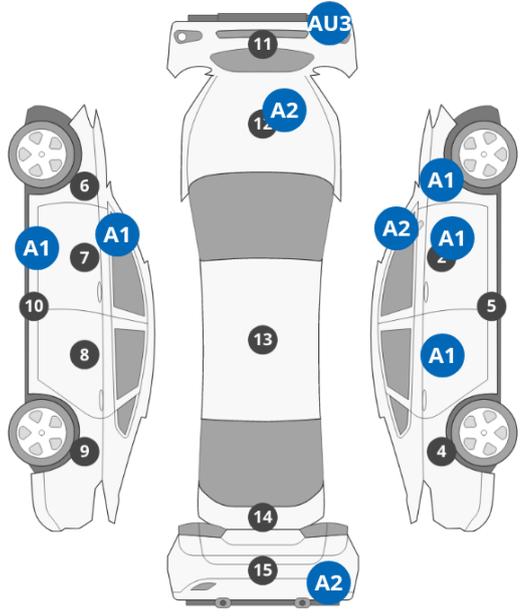
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.9	102	100	104
2	Boot Lid	98.5	95	96	105
3	Roof	91.2	98	85	86/96
4	Left Front Fender	89.9	93	88	89
5	Left Front Door	90.0	89	88	93
6	Center Panel Left				
7	Left Rear Door	91.3	92	89	94
8	Left Back Panel	97.8	103	97	94
9	Right Front Fender	95.2	90	96	100
10	Right Front Door	99.6	98	107	94
11	Center Panel Right				
12	Right Rear Door	107.6	108	105	110
13	Right Back Panel	105.2	106	97	113

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
power steering issue. With warranty booklet, spare tire and seat cover. Without jack and tools. 1 key. No LTO plate.