

General Information

Date & Time: 26, Sep, 2025 11:03

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	20,862
Registration No.	FAR1597	Chassis No.	PA1B18F38P4234125
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



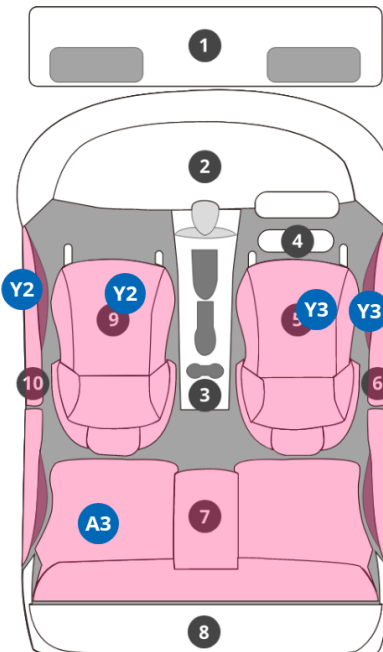
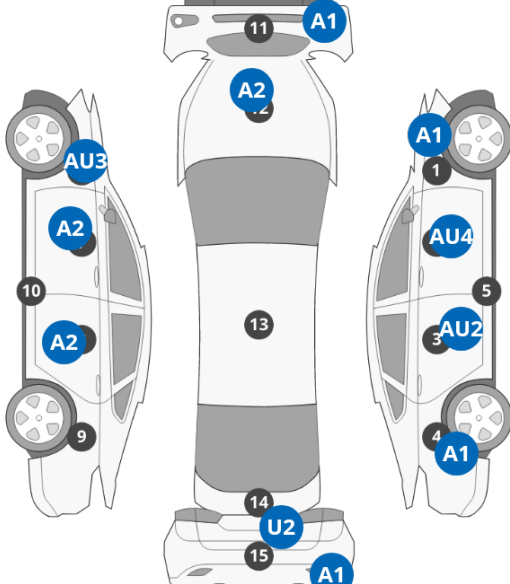
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.7	98	104	97
2	Boot Lid	156.3	127	171	171
3	Roof	92.2	97	93	87/92
4	Left Front Fender	94.3	95	95	93
5	Left Front Door	95.8	95	96	97
6	Center Panel Left				
7	Left Rear Door	97.7	100	98	95
8	Left Back Panel	98.4	102	96	98
9	Right Front Fender	99.5	107	95	97
10	Right Front Door	99.6	96	104	99
11	Center Panel Right				
12	Right Rear Door	98.3	97	96	102
13	Right Back Panel	94.0	90	92	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Cut, Crack - Medium / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No LTO plate/with spare tire/No jack and tools/No reverse camera/No spare key//No warranty booklet</p>