

General Information

Date & Time: 19, Sep, 2025 20:28

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	28,072
Registration No.	FAR3255	Chassis No.	PA1B18F34R4243326
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



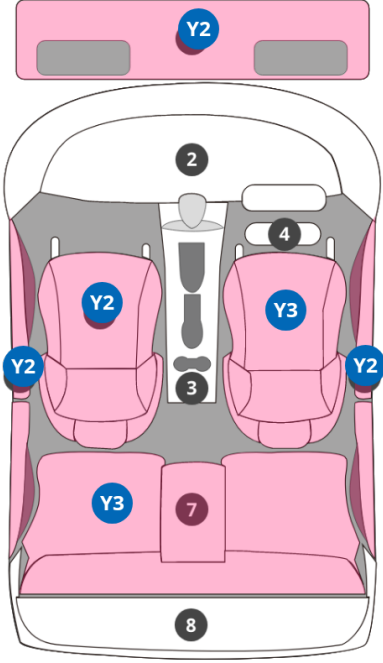
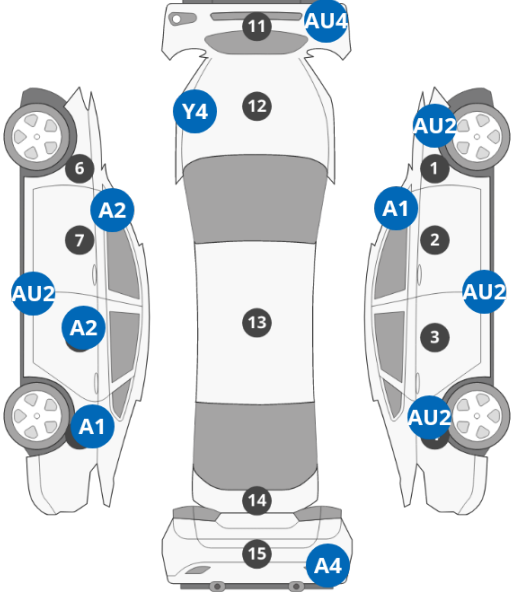
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	241.3	262	208	254
2	Boot Lid	110.3	105	117	109
3	Roof	109.5	118	108	102/110
4	Left Front Fender	154.6	154	162	148
5	Left Front Door	101.0	99	104	100
6	Center Panel Left				
7	Left Rear Door	105.6	110	106	101
8	Left Back Panel	107.6	107	110	106
9	Right Front Fender	174.0	181	177	164
10	Right Front Door	103.0	102	101	106
11	Center Panel Right				
12	Right Rear Door	105.3	100	105	111
13	Right Back Panel	104.0	102	101	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Crack, Gap - Large</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With warranty booklet, spare tire and jack. Without tools and seat cover. 1 key. With LTO plate.</p>