

General Information

Date & Time: 10, Oct, 2025 20:39

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	11,785
Registration No.	FAR4793	Chassis No.	PA1B18F34R4247361
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



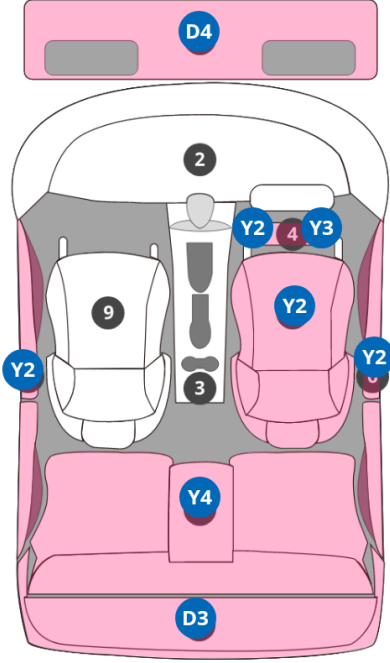
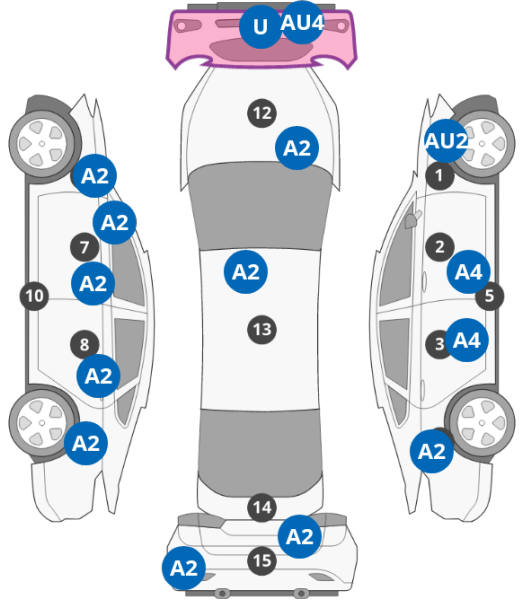
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	110	100	104
2	Boot Lid	100.3	97	96	108
3	Roof	91.4	91	99	83/93
4	Left Front Fender	85.6	87	85	85
5	Left Front Door	92.3	96	91	91
6	Center Panel Left				
7	Left Rear Door	95.3	100	93	93
8	Left Back Panel	99.3	104	95	99
9	Right Front Fender	93.7	87	100	94
10	Right Front Door	93.1	93	88	99
11	Center Panel Right				
12	Right Rear Door	93.7	91	97	94
13	Right Back Panel	95.2	97	94	95

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Loose, Deformed - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Loose, Deformed - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small	Remarks Front Bumper, Grille, Lamps - Repair mark - Difference in Color / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Member (Bolted) - Dent - Yes / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
Possible flooding. Foglamps missing. Front bumper right side repaired. missing Toyota Emblem at front. No rear interior lights. Front interior light issue. Trunk floor worked. 3 keys. Without warranty booklet, spare tire, jack, tools and seat cover. engine undercover loose. crack/gap at front bumper.