

## General Information

Date & Time: 19, Sep, 2025 20:26

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	5,770
<b>Registration No.</b>	FAR5315	<b>Chassis No.</b>	PA1B18F37R4247483
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



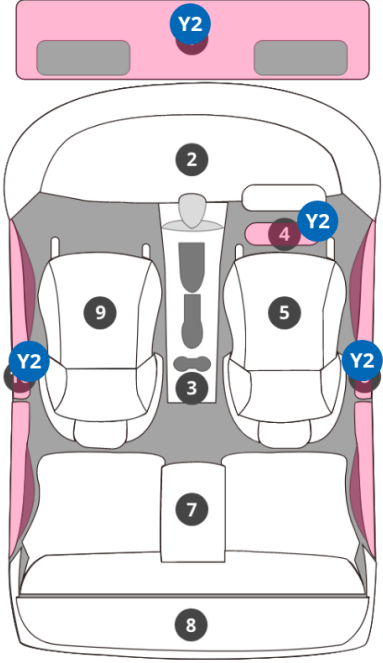
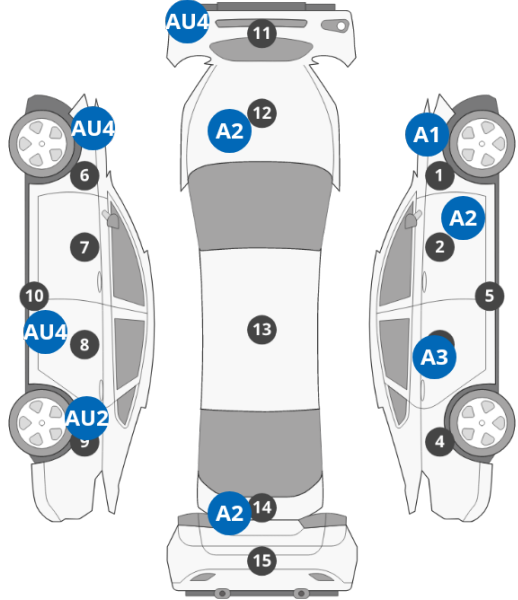
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.8	112	99	103
2	Boot Lid	99.7	98	98	103
3	Roof	92.5	95	92	92/91
4	Left Front Fender	85.7	88	83	87
5	Left Front Door	94.9	97	91	97
6	Center Panel Left				
7	Left Rear Door	100.5	114	96	92
8	Left Back Panel	100.4	105	96	100
9	Right Front Fender	92.3	92	95	90
10	Right Front Door	96.2	99	94	96
11	Center Panel Right				
12	Right Rear Door	92.9	85	93	101
13	Right Back Panel	95.5	91	94	102

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small</p>	<p><b>Remarks</b> Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Front Fender, Molding - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet, spare tire and seat cover. Without jack and tools. 1 key. No LTO plate.</p>