

General Information

Date & Time: 11, Oct, 2025 21:21

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	15,973
Registration No.	FAR8190	Chassis No.	PA1B18F30R4256168
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



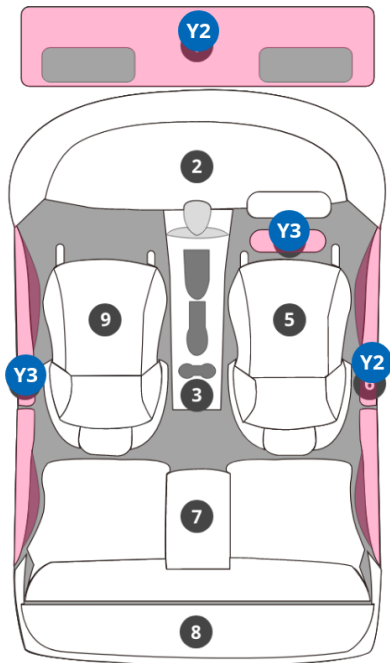
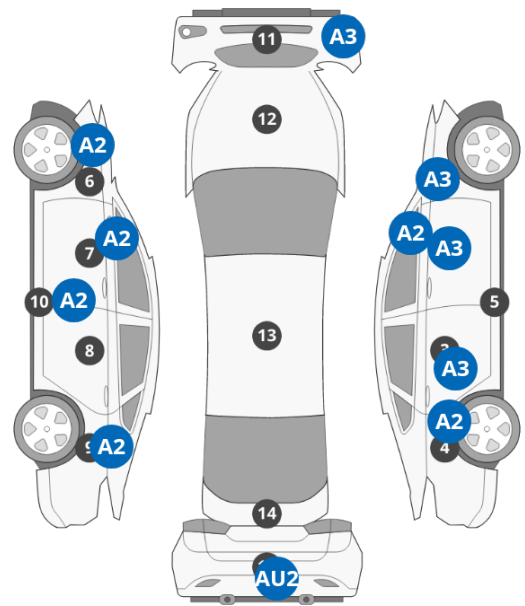
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.4	108	94	108
2	Boot Lid	96.7	99	92	100
3	Roof	99.0	109	95	89/103
4	Left Front Fender	91.1	93	90	91
5	Left Front Door	92.7	93	95	91
6	Center Panel Left				
7	Left Rear Door	107.0	123	101	97
8	Left Back Panel	101.7	110	96	99
9	Right Front Fender	100.7	106	100	96
10	Right Front Door	93.2	100	92	88
11	Center Panel Right				
12	Right Rear Door	182.6	177	185	186
13	Right Back Panel	98.6	98	96	102

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium	Remarks (R) Rear Door - Repair Traces - Yes / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

Possible flooding. Large grime at trunk room. Without tools. With warranty booklet, spare tire, jack and seat cover. 1 key. No LTO plate.