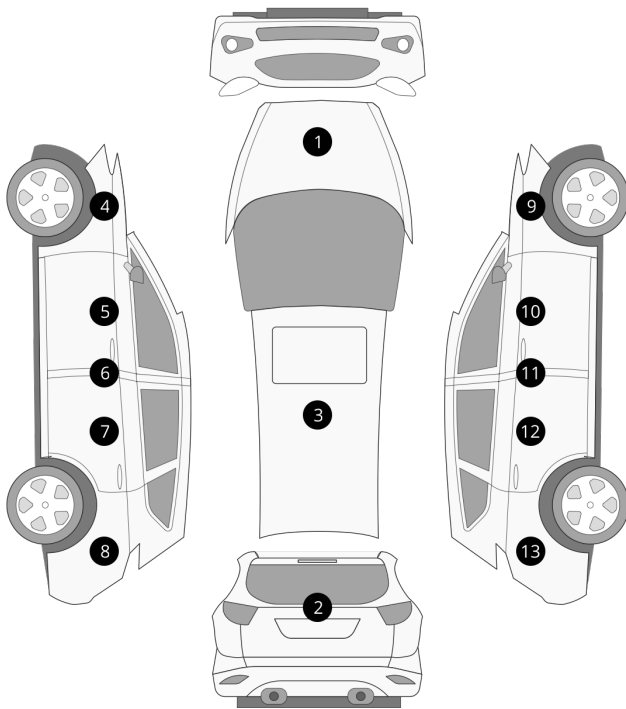


General Information

Date & Time: 09, Oct, 2025 18:47

Make	Suzuki	Model	Dzire
YOM	2024	Odo Meter Reading	1,663
Registration No.	GBC5586	Chassis No.	MBHZF63SXR470198
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



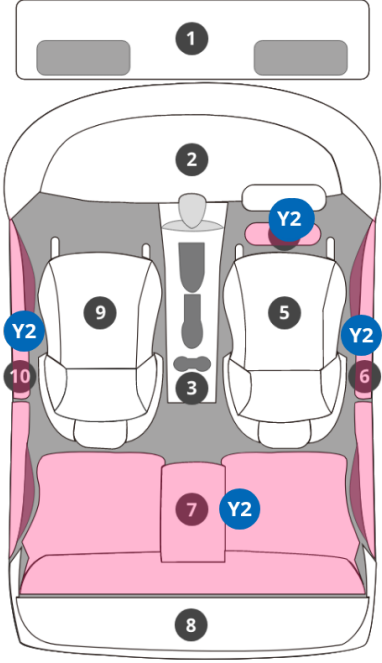
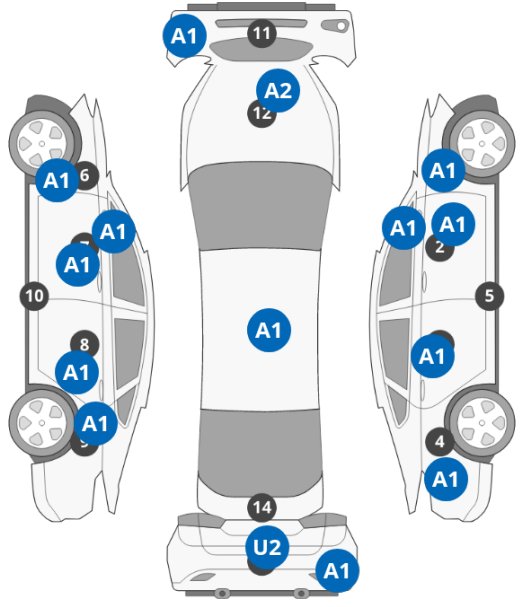
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	190.6	357	102	113
2	Boot Lid	89.8	92	93	85
3	Roof	111.0	109	104	117/114
4	Left Front Fender	103.3	111	97	102
5	Left Front Door	101.5	103	96	106
6	Center Panel Left				
7	Left Rear Door	94.2	98	95	90
8	Left Back Panel	100.8	100	100	103
9	Right Front Fender	98.4	112	101	82
10	Right Front Door	99.5	100	100	99
11	Center Panel Right				
12	Right Rear Door	101.6	104	100	101
13	Right Back Panel	109.6	100	116	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / Mat Other - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small	Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, no LTO plate, scratches on tail light